

DTC**B1785****Front Occupant Classification Sensor LH Collision Detection****DESCRIPTION**

DTC B1785 is output when the occupant classification ECU receives a collision detection signal sent by the front occupant classification sensor LH if an accident occurs.

DTC B1785 is also output when the front seat assembly RH is subjected to a strong impact, even if an actual accident does not occur.

However, when the occupant classification ECU outputs a collision detection signal, even if the vehicle is not in a collision, DTC B1785 can be cleared by "zero point calibration" and "sensitivity check".

Therefore, if DTC B1785 is output, first perform "zero point calibration" and "sensitivity check".

DTC No.	DTC Detecting Condition	Trouble Area
B1785	- Front seat assembly RH malfunction - Occupant classification ECU malfunction - Front occupant classification sensor LH sensed large load	- Occupant classification ECU - Front seat assembly RH (Front occupant classification sensor LH)

WIRING DIAGRAM

See page [RS-261](#).

INSPECTION PROCEDURE**1 PERFORM ZERO POINT CALIBRATION**

- Connect the intelligent tester to the DLC3.
- Turn the power switch on (IG).
- Using the intelligent tester, perform "zero point calibration" (See page [RS-239](#)).

OK:

"COMPLETED" is displayed.

NG

Go to step 4

OK

2 PERFORM SENSITIVITY CHECK

- Using the intelligent tester, perform "sensitivity check" (See page [RS-239](#)).

Standard value:

27 to 33 kg (59.52 to 72.75 lb)

NG

Go to step 4

OK

3 CHECK DTC

- Turn the power switch on (IG).
- Clear the DTCs stored in the occupant classification ECU (See page [RS-248](#)).

- (c) Clear the DTCs stored in the center airbag sensor assembly (See page [RS-41](#)).
- (d) Turn the power switch off.
- (e) Turn the power switch on (IG).
- (f) Check the DTCs (See page [RS-248](#)).

OK:

DTC B1785 is not output.

HINT:

Codes other than DTC B1785 may be output at this time, but they are not related to this check.

OK

END

NG

4

REPLACE FRONT SEAT ASSEMBLY RH

- (a) Turn the power switch off.
- (b) Disconnect the negative (-) terminal cable from the battery.
- (c) Replace the front seat assembly RH (See page [SE-16](#) for power seat or [SE-29](#) for manual seat).

HINT:

Perform the inspection using parts from a normal vehicle if possible.

NEXT

5

PERFORM ZERO POINT CALIBRATION

- (a) Connect the negative (-) terminal cable to the battery.
- (b) Connect the intelligent tester to the DLC3.
- (c) Turn the power switch on (IG).
- (d) Using the intelligent tester, perform "zero point calibration" (See page [RS-239](#)).

OK:

"COMPLETED" is displayed.

NG

Go to step 8

OK

6

PERFORM SENSITIVITY CHECK

- (a) Using the intelligent tester, perform "sensitivity check" (See page [RS-239](#)).

Standard value:

27 to 33 kg (59.52 to 72.75 lb)

NG

Go to step 8

OK

7 CHECK DTC

- (a) Turn the power switch on (IG).
- (b) Clear the DTCs stored in the occupant classification ECU (See page [RS-248](#)).
- (c) Clear the DTCs stored in the center airbag sensor assembly (See page [RS-41](#)).
- (d) Turn the power switch off.
- (e) Turn the power switch on (IG).
- (f) Check the DTCs (See page [RS-248](#)).

OK:**DTC B1785 is not output.****HINT:**

Codes other than DTC B1785 may be output at this time, but they are not related to this check.

OK**END****NG****8 REPLACE OCCUPANT CLASSIFICATION ECU**

- (a) Turn the power switch off.
- (b) Disconnect the negative (-) terminal cable from the battery.
- (c) Replace the occupant classification ECU (See page [RS-445](#)).

NEXT**9 PERFORM ZERO POINT CALIBRATION**

- (a) Connect the negative (-) terminal cable to the battery.
- (b) Connect the intelligent tester to the DLC3.
- (c) Turn the power switch on (IG).
- (d) Using the intelligent tester, perform "zero point calibration" (See page [RS-239](#)).

OK:**"COMPLETED" is displayed.****NEXT****10 PERFORM SENSITIVITY CHECK**

- (a) Using the intelligent tester, perform "sensitivity check" (See page [RS-239](#)).

Standard value:**27 to 33 kg (59.52 to 72.75 lb)**

NEXT

END