

DTC**P0630****VIN not Programmed or Mismatch - ECM / PCM****DESCRIPTION**

DTC P0630 is set when the Vehicle Identification Number (VIN) is not stored in the Engine Control Module (ECM) or the input VIN is not accurate. Input the VIN with the intelligent tester.

DTC No.	DTC Detection Condition	Trouble Area
P0630	- VIN is not stored in ECM. - Input VIN in ECM is not accurate.	ECM

MONITOR STRATEGY

Related DTCs	P0630: VIN not programmed
Required Sensors/Components (Main)	ECM
Required Sensors/Components (Related)	-
Frequency of Operation	Continuous
Duration	0.5 seconds
MIL Operation	Immediate
Sequence of Operation	None

ES**TYPICAL ENABLING CONDITIONS**

The monitor will run whenever the following DTCs are not present	None
Battery voltage	8 V or more
Ignition switch	ON
Starter	OFF

TYPICAL MALFUNCTION THRESHOLDS

VIN code	Not programmed
----------	----------------

COMPONENT OPERATING RANGE

VIN code	Programmed
----------	------------

INSPECTION PROCEDURE**1****CHECK CURRENT DTC****NOTICE:**

If P0630 is present, the VIN must be input to the ECM using the intelligent tester. However, all DTCs are cleared automatically by the tester when inputting the VIN. If DTCs other than P0630 are present, check them first.

NEXT

2	INPUT VIN WITH INTELLIGENT TESTER
---	-----------------------------------

HINT:
Refer to "REGISTRATION" (See page [ES-9](#)).

NEXT

END