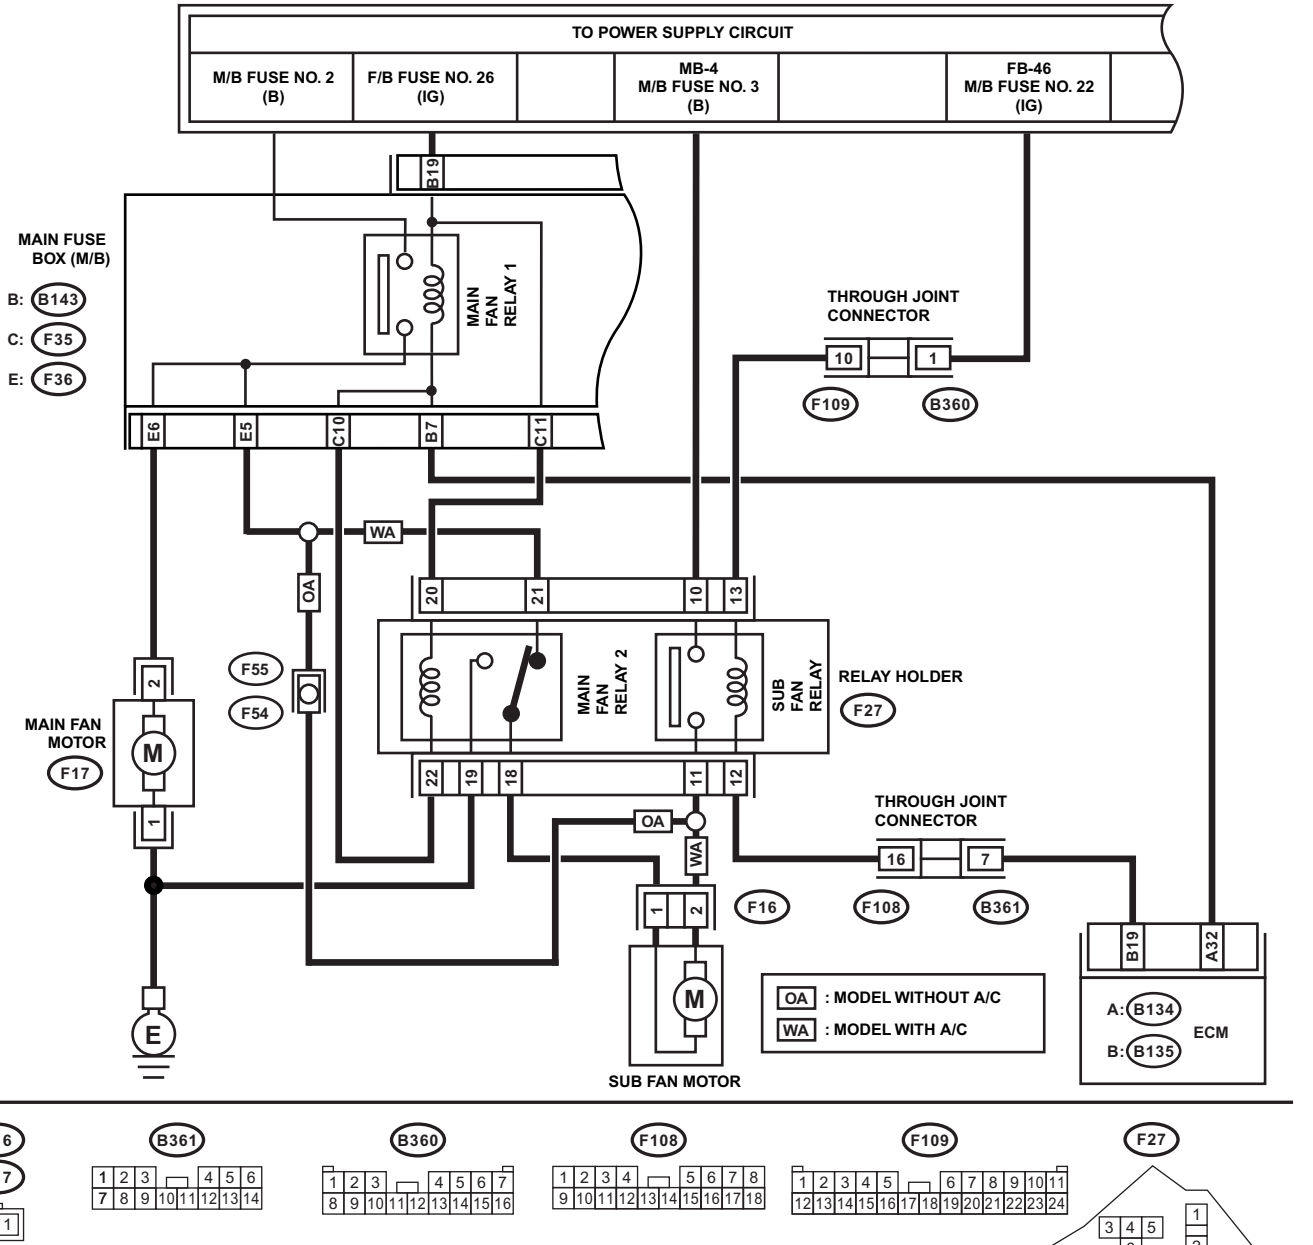
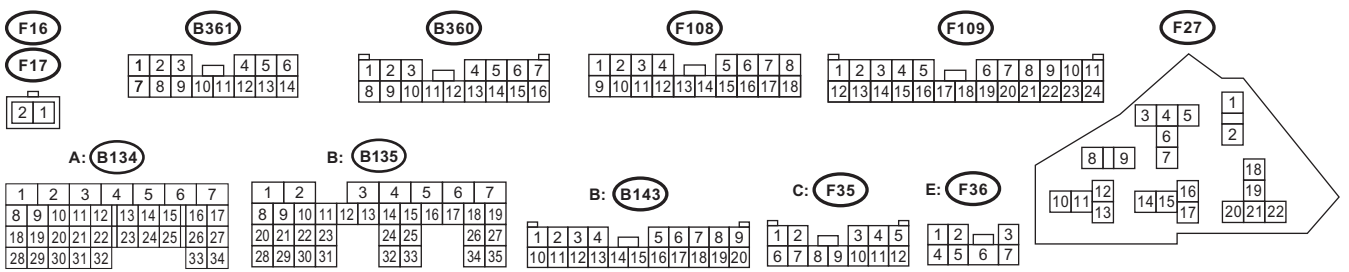

TO POWER SUPPLY CIRCUIT
M/B FUSE NO. 2 (B)
F/B FUSE NO. 26 (IG)
MB-4 M/B FUSE NO. 3 (B)
FB-46 M/B FUSE NO. 22 (IG)
B19
MAIN FUSE BOX (M/B)
B: B143
C: F35
E: F36
MAIN FAN RELAY 1
THROUGH JOINT CONNECTOR
10
1
F109
B360
E6
E5
C10
B7
C11
WA
OA
20
21
10
13
F55
F54
MAIN FAN RELAY 2
SUB FAN RELAY
RELAY HOLDER
F27
MAIN FAN MOTOR
F17
2
M
1
22
19
18
11
12
OA
WA
THROUGH JOINT CONNECTOR
16
7
F16
F108
B361
1
2
M
B19
A32
A: B134
B: B135
ECM
E
SUB FAN MOTOR
OA : MODEL WITHOUT A/C
WA : MODEL WITH A/C


F16
F17
2 1
B361
1 2 3 4 5 6
7 8 9 10 11 12 13 14
B360
1 2 3 4 5 6 7
8 9 10 11 12 13 14 15 16
F108
1 2 3 4 5 6 7 8
9 10 11 12 13 14 15 16 17 18
F109
1 2 3 4 5 6 7 8 9 10 11
12 13 14 15 16 17 18 19 20 21 22 23 24
F27
3 4 5
1
2
6
7
8 9
18
19
10 11 12 13
14 15 16 17
20 21 22
A: B134
1 2 3 4 5 6 7
8 9 10 11 12 13 14 15 16 17
18 19 20 21 22 23 24 25 26 27
28 29 30 31 32 33 34
B: B135
1 2 3 4 5 6 7
8 9 10 11 12 13 14 15 16 17 18 19
20 21 22 23 24 25 26 27
28 29 30 31 32 33 34 35
B: B143
1 2 3 4 5 6 7 8 9
10 11 12 13 14 15 16 17 18 19 20
C: F35
1 2 3 4 5
6 7 8 9 10 11 12
E: F36
1 2 3
4 5 6 7

CO-02748