

REGISTRATION

1. REGISTRATION OF RECOGNITION CODE

HINT:


- The add mode is used to retain the already registered codes while registering a new recognition code. This mode is used when adding a transmitter. If the number of registered codes exceeds 4, the previously registered code will be correspondingly erased in order, starting from the code registered first.
- The rewrite mode is used to erase all the previously registered codes and register only new recognition codes. This mode is used when exchanging the transmitter or the door control receiver for new one.
- The prohibition mode is used to erase all the registered codes and cancel the wireless door lock function. Use this mode when the transmitter is lost.
- The confirmation mode is used to confirm how many recognition codes have already been registered before an additional registration of a recognition code.
- All the following registration procedures must be performed in order continuously.
 - (a) The vehicle should be in the following conditions.
 - (1) No key is inserted in the ignition key cylinder.
 - (2) The driver's door is opened (the other doors are closed).
 - (3) The driver's door is unlocked.
 - (b) Perform the following operations to select the desired mode.
 - (1) Insert and remove the key from the ignition switch twice within 5 seconds.
 - (2) After the above operations, close and open the driver door twice within 40 seconds. Then insert the key into the ignition key cylinder and remove it.
 - (3) After the above operations, close and open the driver door twice within 40 seconds. Then insert the key into the ignition key cylinder and close the door.

- (4) Turn the ignition switch from LOCK to ON and back to LOCK at approximately 1 second interval 1 to 5 times to select a mode (see the illustration). Then remove the key from the ignition key cylinder.

Number of ON-LOCK Operations of the Ignition Switch


Add Mode:

ON-LOCK operation: 1 time

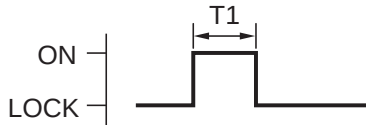


Confirmation Mode:

ON-LOCK operation: 3 times

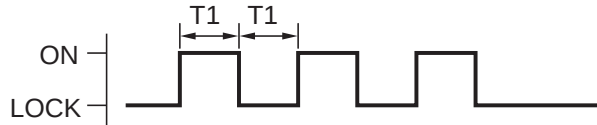

Rewrite Mode:

ON-LOCK operation: 2 times

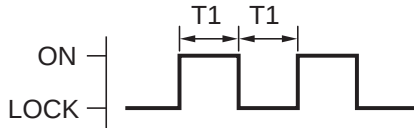

Prohibition Mode:

ON-LOCK operation: 5 times



T1: Approx. 1 second

N


B110068E02

NOTICE:

If the number of the ON-LOCK operations of the ignition switch is 0, 4 or 6 or more, there will be no response to inform which mode has been selected.

- (5) After selecting a mode, the integration relay automatically performs the power door LOCK-UNLOCK operation within 3 seconds to inform the selected mode (see the illustration).

Response to a Selected Mode (Power Door Lock Operation):

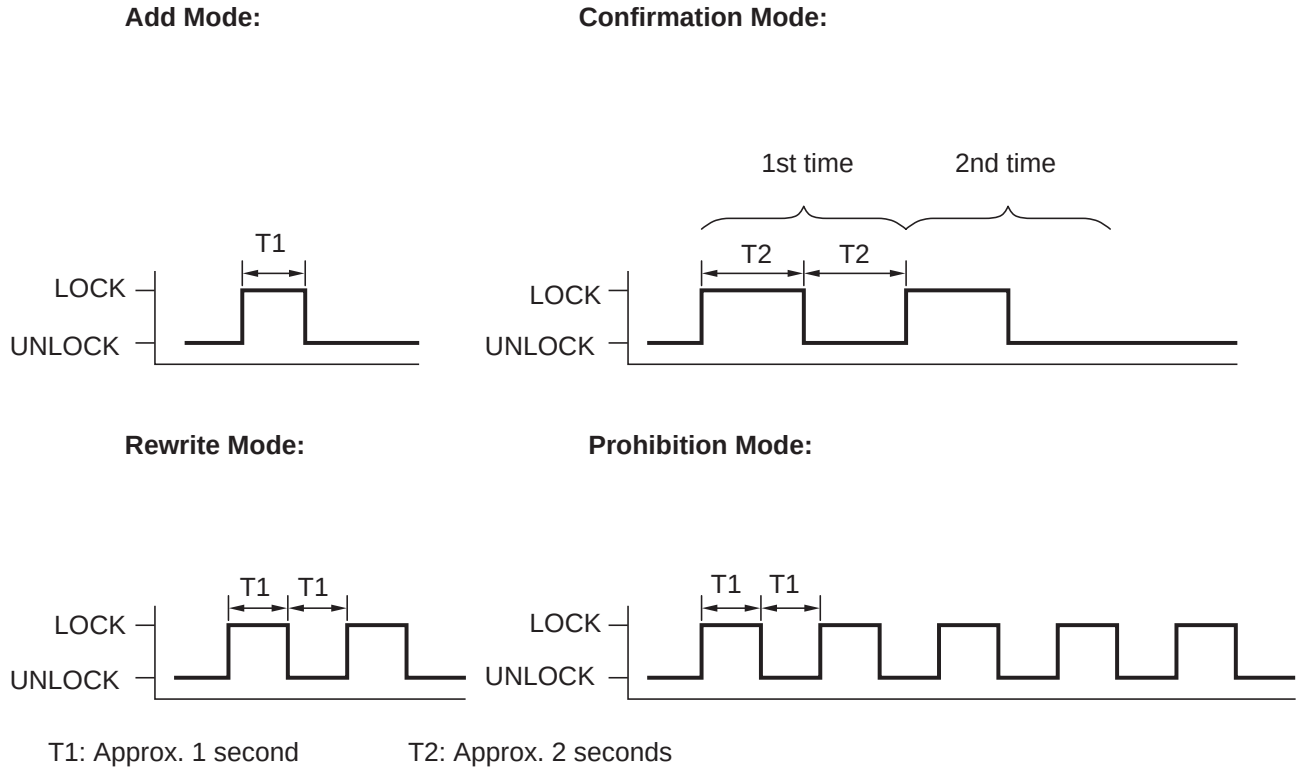

N

B110069E05

HINT:


- In the confirmation mode, the LOCK-UNLOCK operation will occur once for each recognition code that has been registered. For example, if 2 recognition codes have been registered, the LOCK-UNLOCK operation will occur 2 times.
- In the confirmation mode, If no recognition codes have been registered, the LOCK-UNLOCK operation will occur 5 times.
- In confirmation mode and prohibition mode, once a LOCK-UNLOCK operation response has occurred, the registration procedure will end.

- (c) Register the new recognition codes (Add mode or Rewrite mode):
- (1) Within 40 seconds after the add mode or the rewrite mode has been selected, press the LOCK and UNLOCK switches on the transmitter switch simultaneously for 1.0 to 1.5 seconds.
Within 3 seconds after the previous operation, press either one of the switches for more than 1.0 second (Procedure "A").
 - (2) Within 3 seconds after the transmitter switch has been released, the LOCK-UNLOCK operation will be automatically performed once if the registration of the recognition code of the transmitter is completed correctly. In case the LOCK-UNLOCK operation is performed twice, the registration of recognition code has failed. Perform the registration procedure from the beginning once again (Procedure "B").

Response to Registration Completion


LOCK-UNLOCK Occurs Once:

Registration of recognition code has been completed.

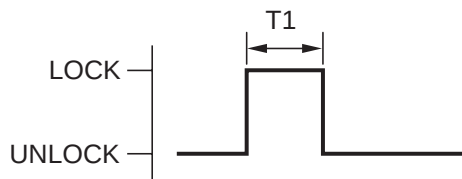

LOCK-UNLOCK Occurs Twice:

Registration of recognition code has failed.

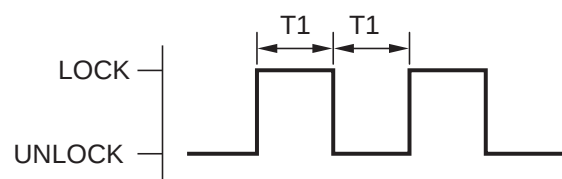

T1: Approx. 1 second

N

B110067E03

- (3) If multiple transmitters need to be registered, repeat procedure "A" and "B" within 40 seconds after the previous registration.
HINT:
 - 4 recognition codes can be registered at once.
 - If even one of the following conditions is satisfied, the registration mode will end.
 - 40 seconds have elapsed after a recognition code has been registered.
 - Any of the doors are opened
 - The key is inserted into the ignition key cylinder.

- 4 recognition codes are registered.