


Last Modified: 3-27-2012	6.4 K	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM000001PZR01CX
Title: AUDIO / VIDEO: AMPLIFIER ANTENNA: COMPONENTS (2013 FR-S)		

COMPONENTS

ILLUSTRATION

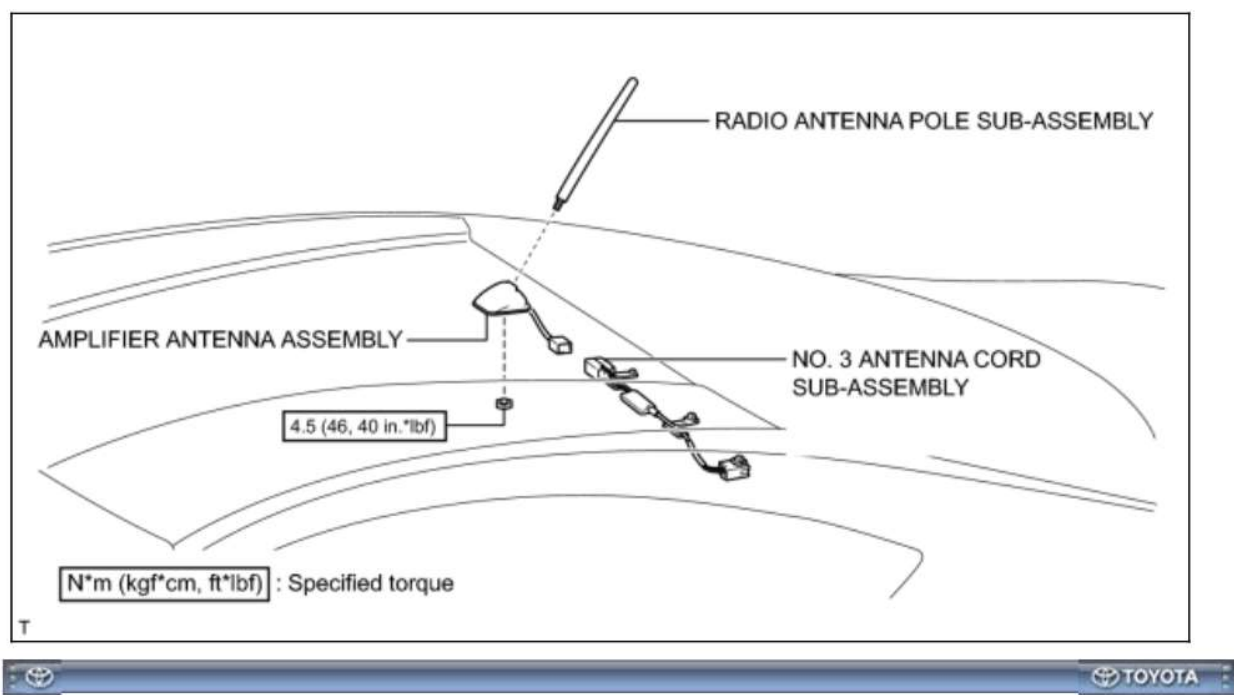

Last Modified: 3-27-2012	6.4 A	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM000001PZQ01TX
Title: AUDIO / VIDEO: AMPLIFIER ANTENNA: INSTALLATION (2013 FR-S)		


INSTALLATION

1. INSTALL NO. 3 ANTENNA CORD SUB-ASSEMBLY

- (a) Engage the 3 clamps and install the No. 3 antenna cord sub-assembly.

2. INSTALL AMPLIFIER ANTENNA ASSEMBLY

- (a) Engage the 2 claws to install the amplifier antenna assembly.

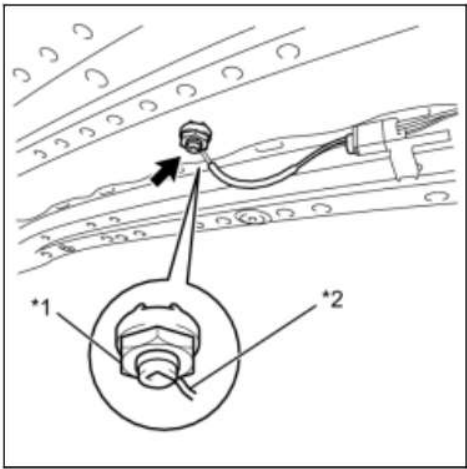

- (b) Place the amplifier antenna cord in the amplifier antenna cutout.

- (c) Install the amplifier antenna assembly with the nut.

Torque: 4.5 N·m (46 kgf·cm, 40in·lbf)

Text in Illustration

*1	Nut
*2	Amplifier Antenna Cord

3. INSTALL RADIO ANTENNA POLE SUB-ASSEMBLY

4. INSTALL ROOF HEADLINING ASSEMBLY

INFO



Last Modified: 3-27-2012	6.4 A	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM000001PZS01UX
Title: AUDIO / VIDEO: AMPLIFIER ANTENNA: REMOVAL (2013 FR-S)		

REMOVAL


1. REMOVE ROOF HEADLINING ASSEMBLY

INFO


2. REMOVE RADIO ANTENNA POLE SUB-ASSEMBLY

INFO


3. REMOVE AMPLIFIER ANTENNA ASSEMBLY

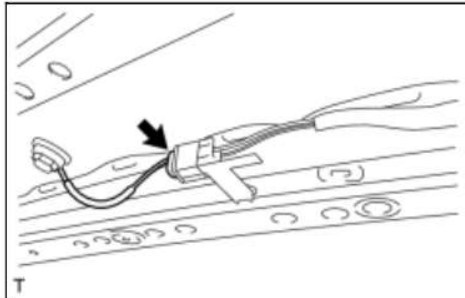

(a) Disconnect the connector.

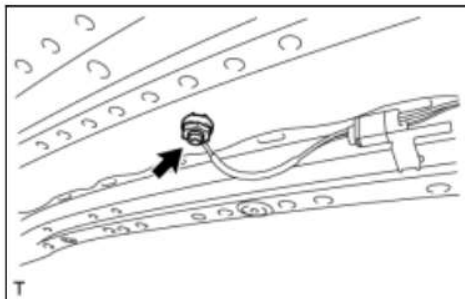


(b) Remove the nut.

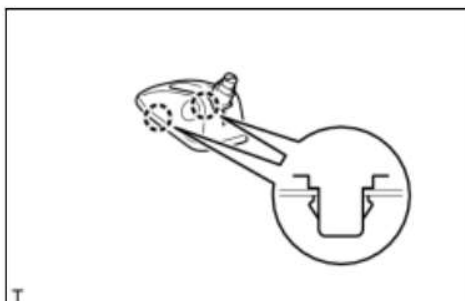

(c) Disengage the 2 claws and remove the amplifier antenna assembly.

4. REMOVE NO. 3 ANTENNA CORD SUB-ASSEMBLY

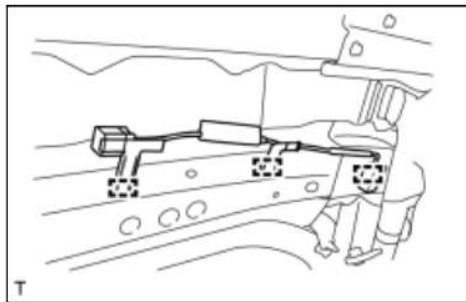


- (a) Disengage the 3 clamps and remove the No. 3 antenna cord sub-assembly.




Last Modified: 3-27-2012	6.4 R	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM0000012A606KX
Title: AUDIO / VIDEO: AUDIO AND VISUAL SYSTEM: PARTS LOCATION (2013 FR-S)		

PARTS LOCATION

ILLUSTRATION

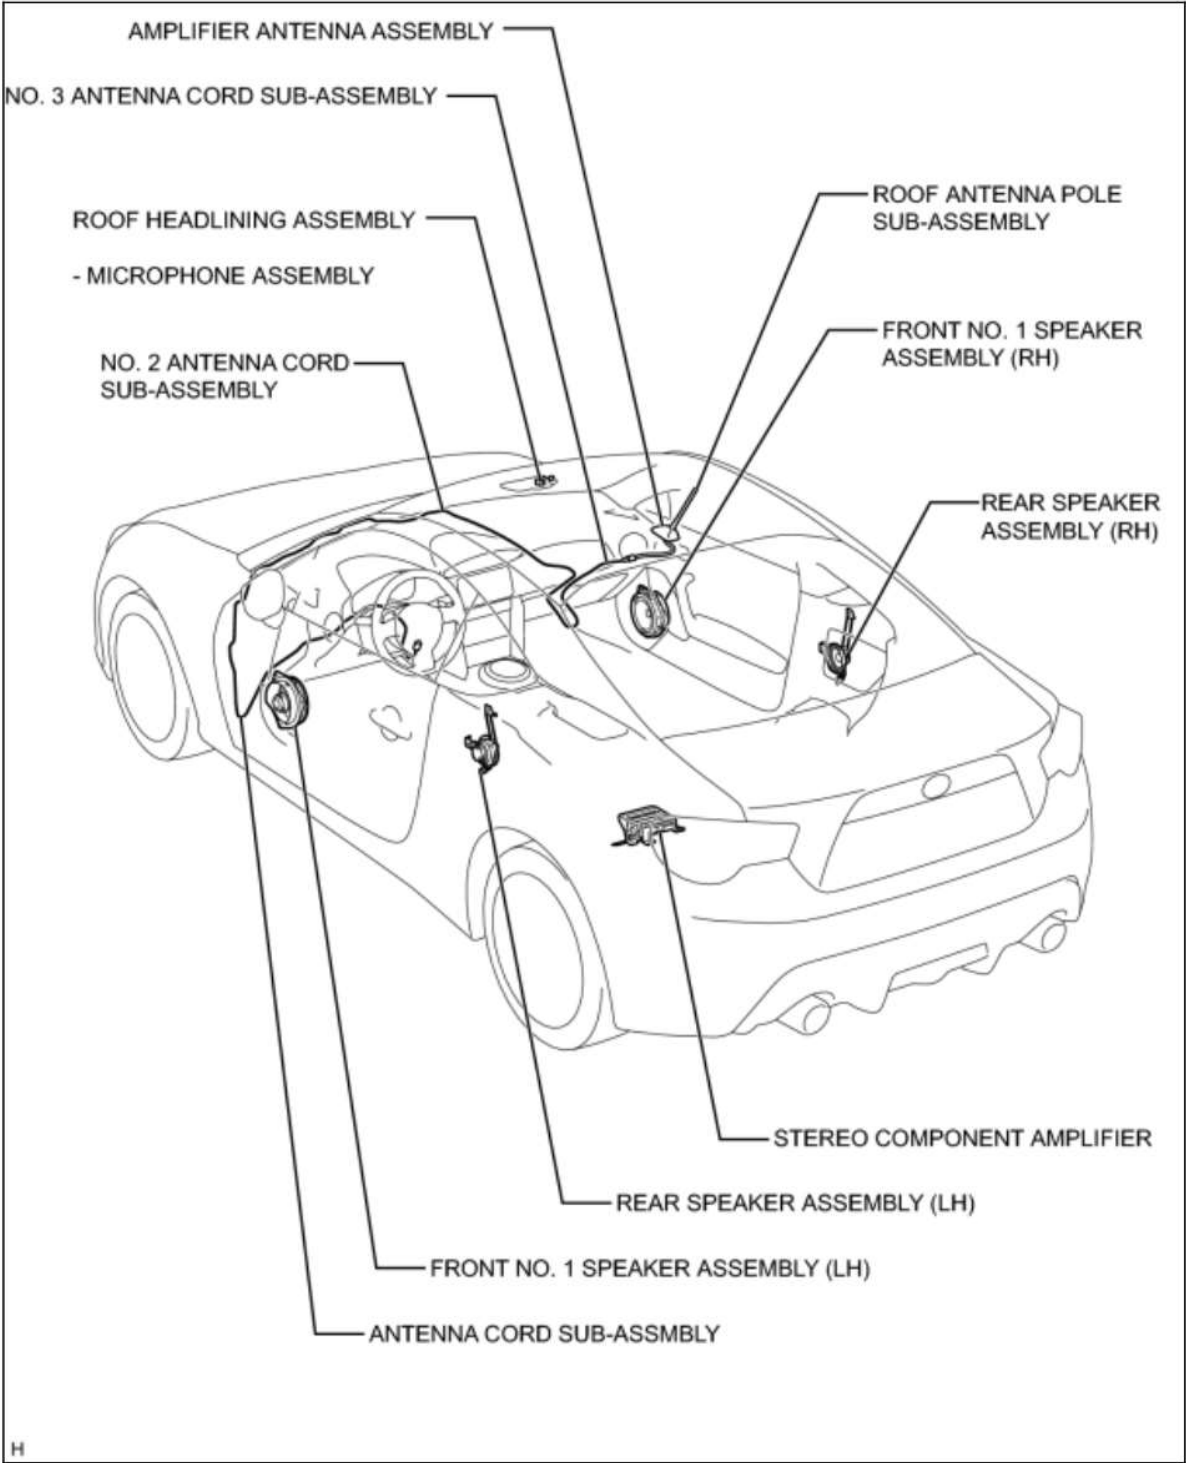



ILLUSTRATION

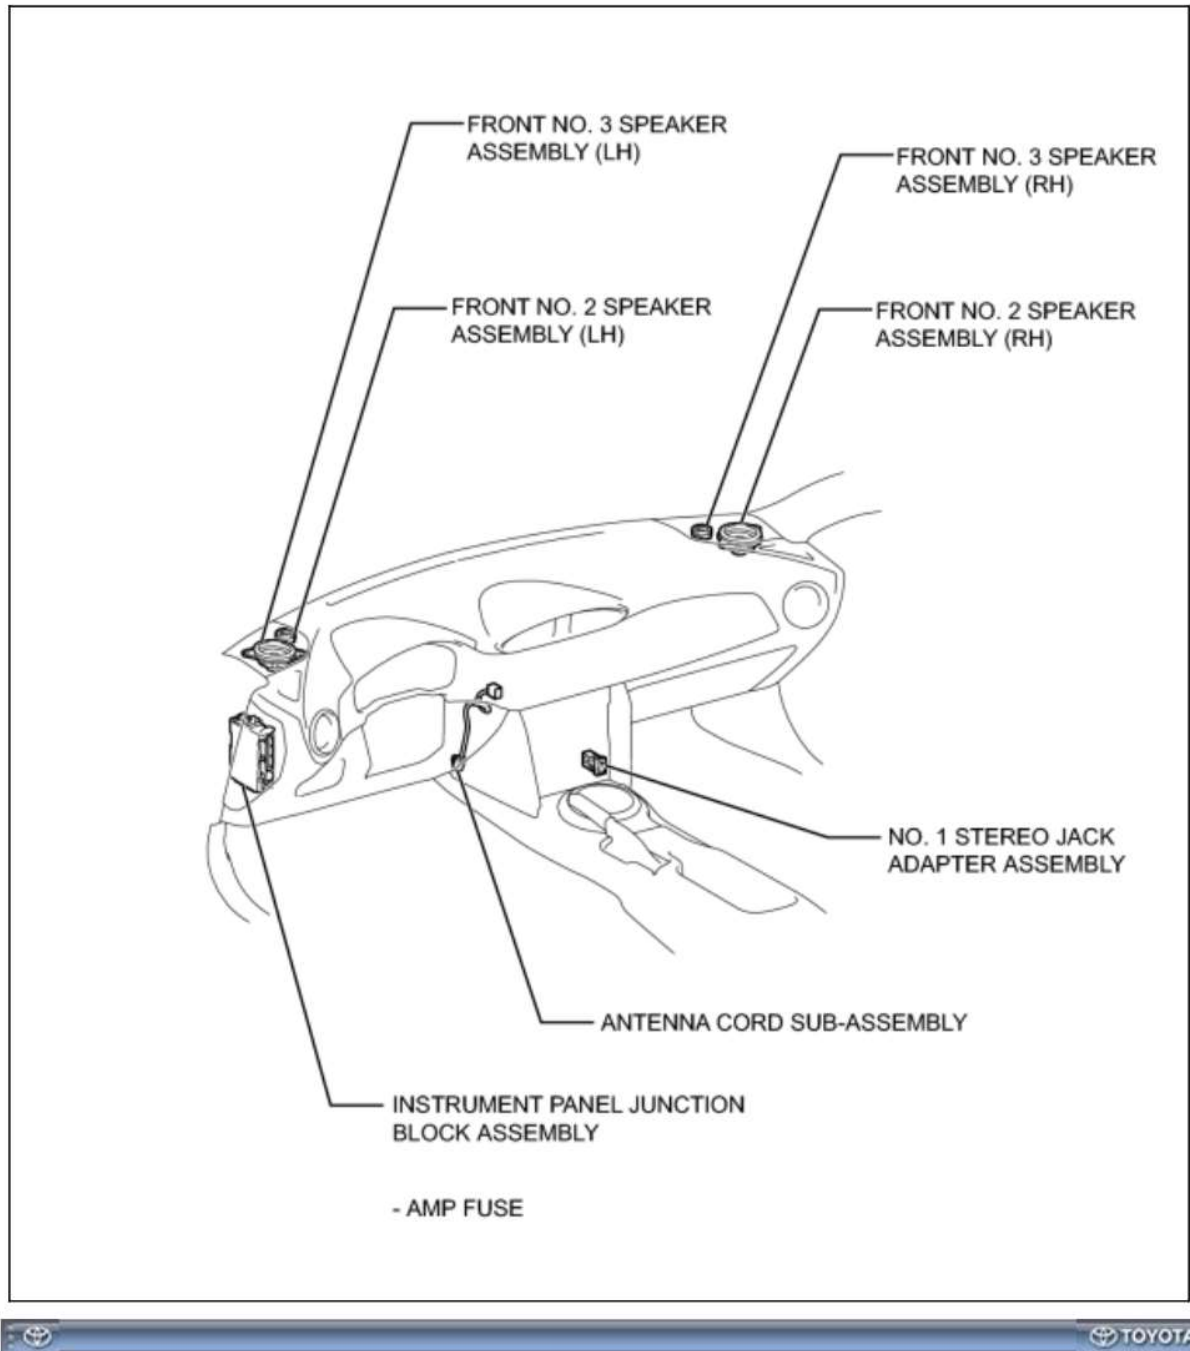

Last Modified: 3-27-2012	6.4 U	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM0000012AB0ADX
Title: AUDIO / VIDEO: AUDIO AND VISUAL SYSTEM: SYSTEM DIAGRAM (2013 FR-S)		

SYSTEM DIAGRAM

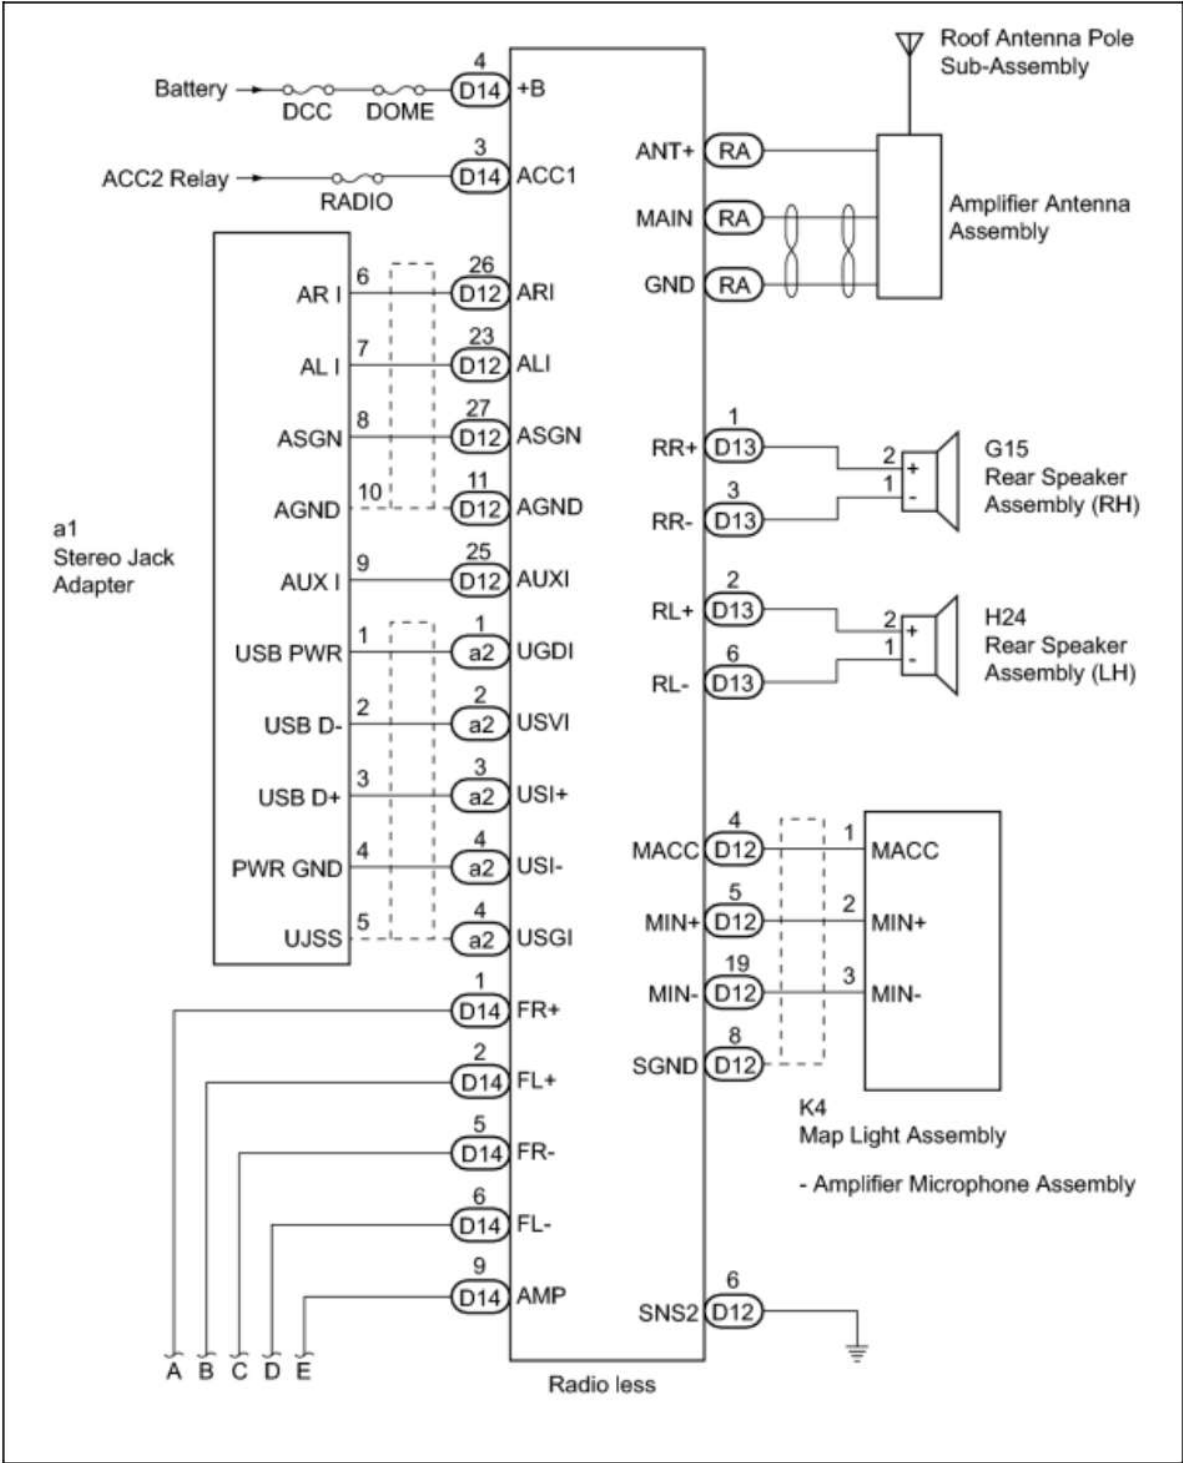


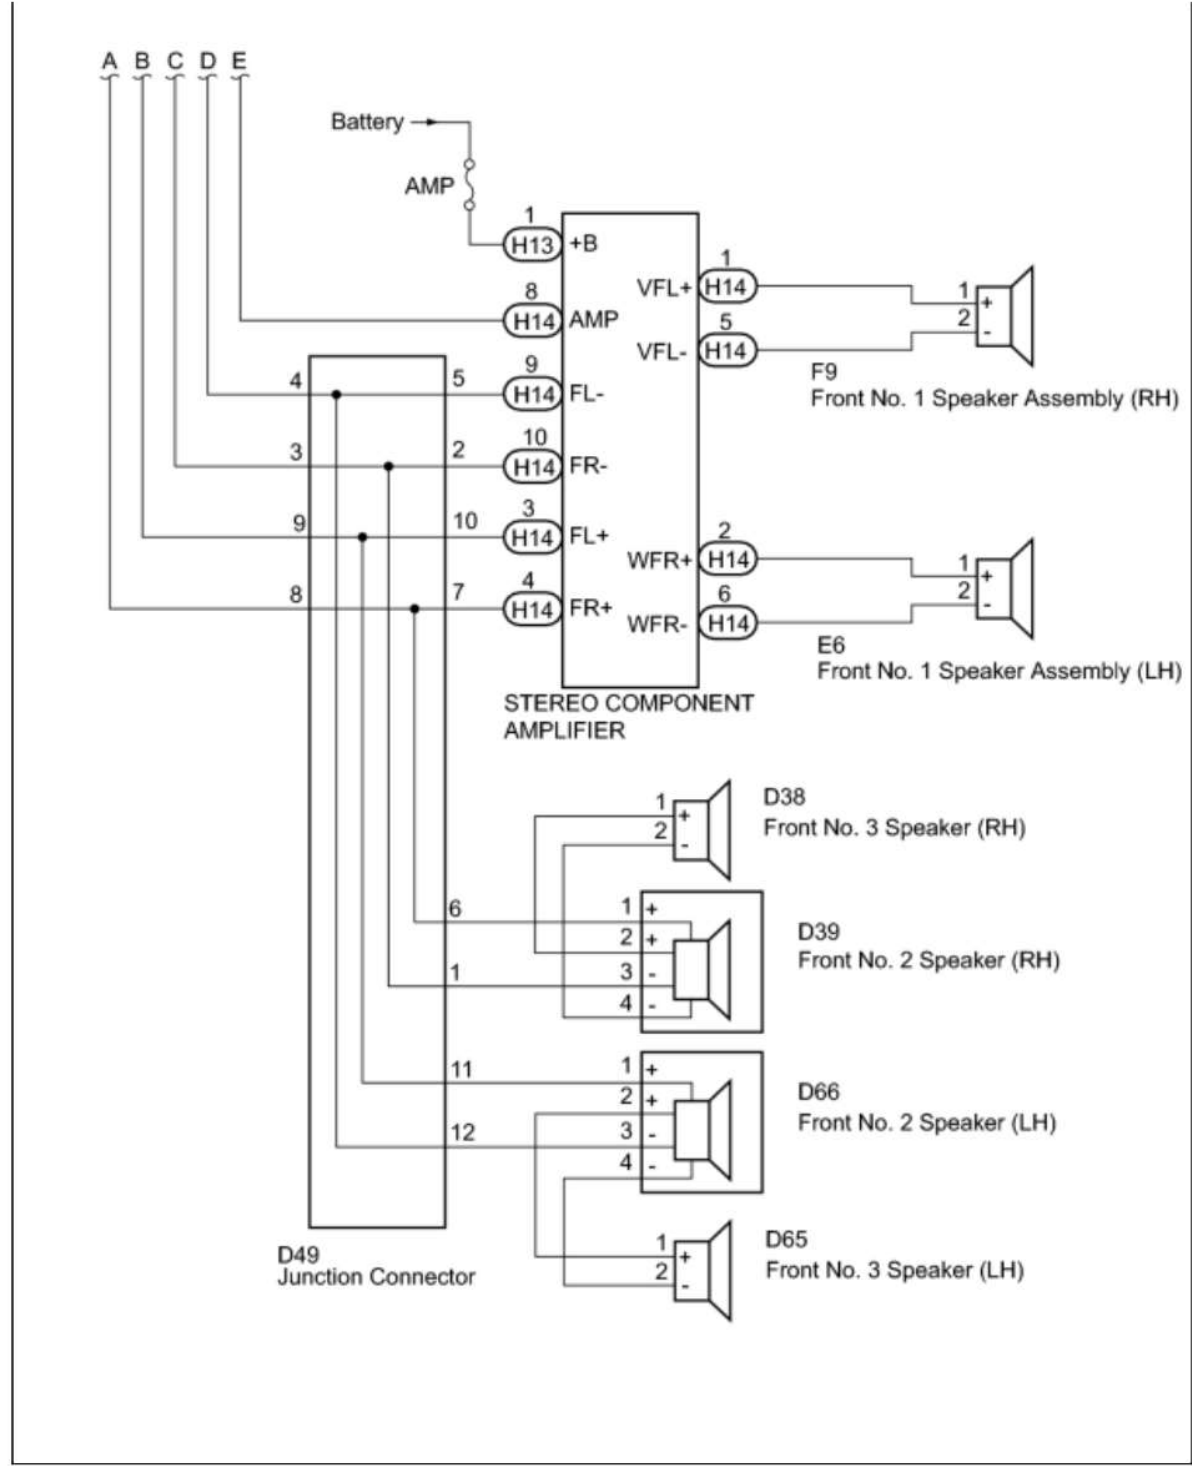

Last Modified: 3-27-2012	6.4 K	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM000001PZ301FX
Title: AUDIO / VIDEO: FRONT DOOR SPEAKER: COMPONENTS (2013 FR-S)		

COMPONENTS

ILLUSTRATION

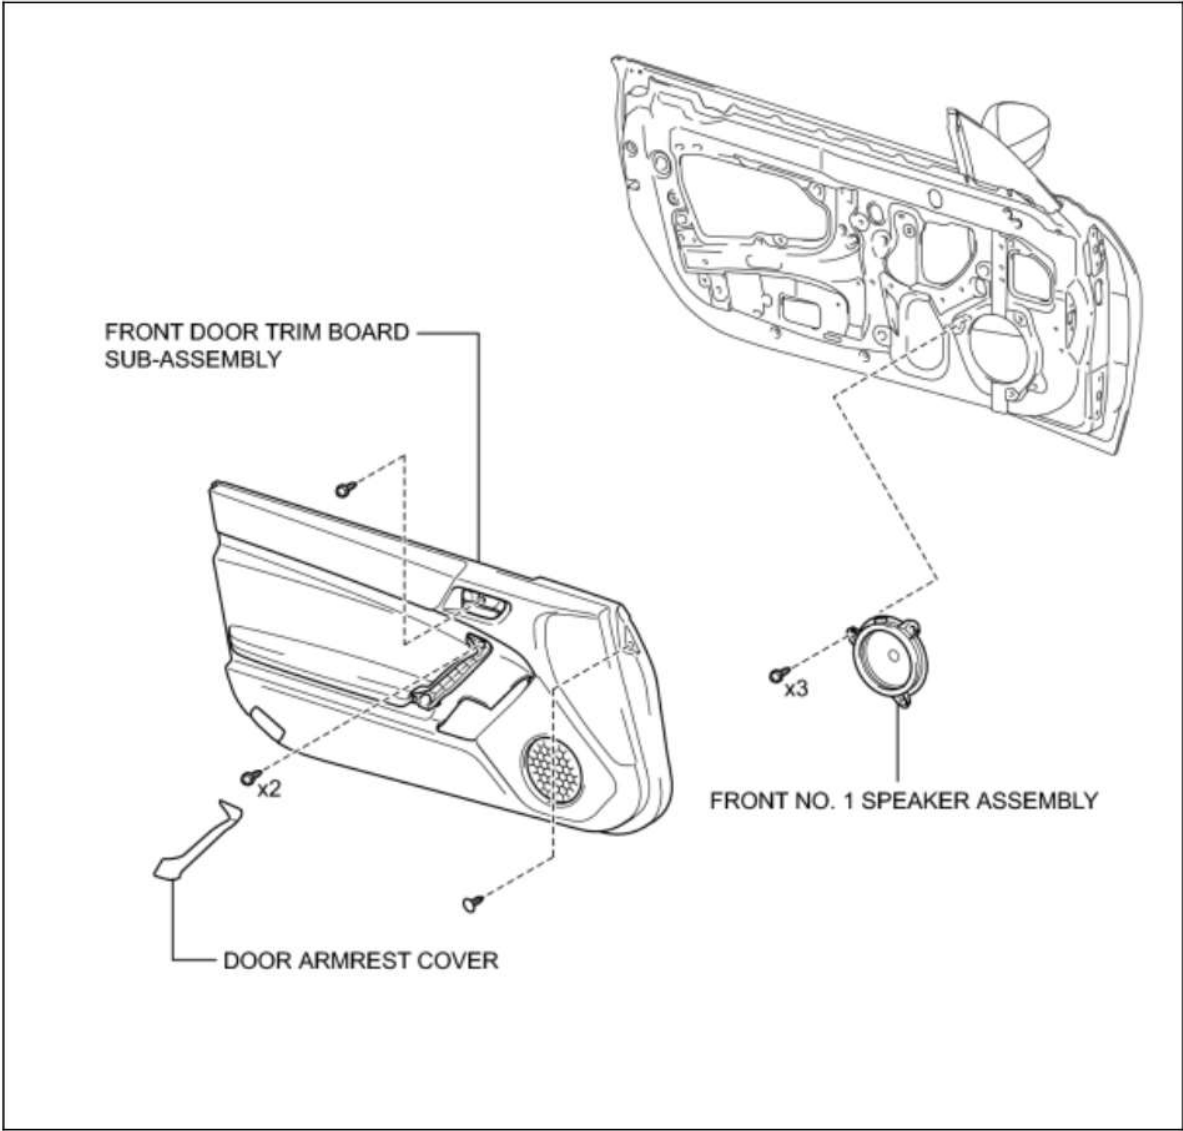

cardiagn.com

Last Modified: 3-27-2012	6.4 G	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM0000020Q204DX
Title: AUDIO / VIDEO: FRONT DOOR SPEAKER: INSPECTION (2013 FR-S)		


INSPECTION

1. INSPECT FRONT NO. 1 SPEAKER ASSEMBLY

- (a) With the speaker installed, check that there is no looseness or other abnormalities.
- (b) Check that there is no foreign matter in the speaker, no tears on the speaker cone or other abnormalities.

(c) Measure the resistance of the speaker.

Standard Resistance:

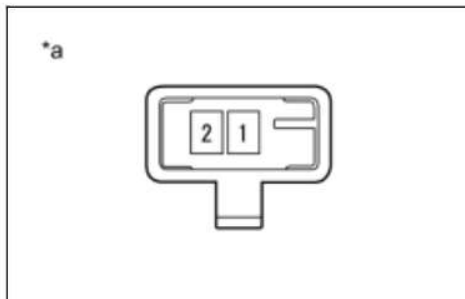

TESTER CONNECTION	CONDITION	SPECIFIED CONDITION
1 - 2	Always	3.4 to 4.6 Ω

If the result is not as specified, replace the speaker.

Text in Illustration

*a	Component without harness connected (Front No. 1 Speaker Assembly)
----	---



Last Modified: 3-27-2012	6.4 A	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM000001PZ201QX
Title: AUDIO / VIDEO: FRONT DOOR SPEAKER: INSTALLATION (2013 FR-S)		

INSTALLATION

HINT:

- Use the same procedure for both the RH and LH sides.
- The procedure described below is for the LH side.

1. INSTALL FRONT NO. 1 SPEAKER ASSEMBLY

(a) Install the front No. 1 speaker assembly with the 3 screws.

NOTICE:

Do not touch the speaker cone.

(b) Connect the connector.

2. INSTALL FRONT DOOR TRIM BOARD SUB-ASSEMBLY

INFO

3. INSTALL DOOR ARMREST COVER

INFO



cardiagn.com

Last Modified: 3-27-2012	6.4 A	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM000001PZ401QX
Title: AUDIO / VIDEO: FRONT DOOR SPEAKER: REMOVAL (2013 FR-S)		

REMOVAL


HINT:

- Use the same procedure for both the RH and LH sides.
- The procedure described below is for the LH side.

1. REMOVE DOOR ARMREST COVER INFO

2. REMOVE FRONT DOOR TRIM BOARD SUB-ASSEMBLY INFO

3. REMOVE FRONT NO. 1 SPEAKER ASSEMBLY

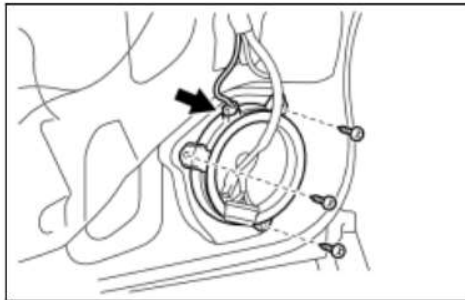

(a) Disconnect the connector.

(b) Remove the 3 screws and front No. 1 speaker assembly.

NOTICE:


Do not touch the speaker cone.



Last Modified: 3-27-2012	6.4 K	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM000003AW400VX
Title: AUDIO / VIDEO: INSTRUMENT PANEL SPEAKER (for 6 Speakers): COMPONENTS (2013 FR-S)		

COMPONENTS

ILLUSTRATION

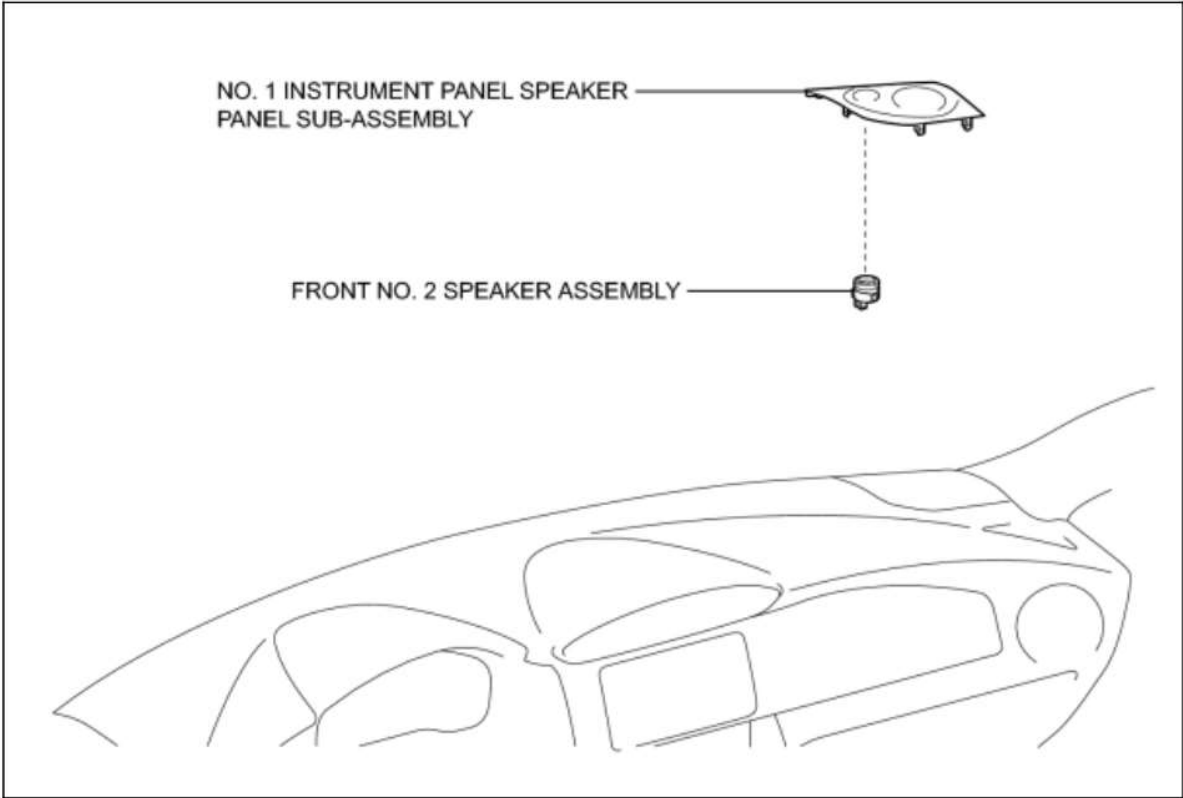

Last Modified: 3-27-2012	6.4 G	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM000000VEM01UX
Title: AUDIO / VIDEO: INSTRUMENT PANEL SPEAKER (for 6 Speakers): INSPECTION (2013 FR-S)		


INSPECTION

1. INSPECT FRONT NO. 2 SPEAKER ASSEMBLY

(a) Check that there is no foreign matter in the front No. 2 speaker assembly, no tears on the front No. 4 speaker assembly cone or other abnormalities.

(b) Measure the resistance of the front No. 2 speaker assembly.

Standard Resistance:

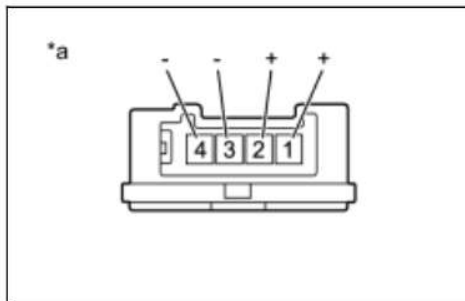

TESTER CONNECTION	CONDITION	SPECIFIED CONDITION
1 (+) - 2 (+)	Always	3.4 to 4.6 Ω
3 (-) - 4 (-)	Always	3.4 to 4.6 Ω

If the result is not as specified, replace the front No. 2 speaker assembly.

Text in Illustration

*a	Component without harness connected (Front No. 2 speaker assembly)
----	---



Last Modified: 3-27-2012	6.4 A	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM000000VEL02GX
Title: AUDIO / VIDEO: INSTRUMENT PANEL SPEAKER (for 6 Speakers): INSTALLATION (2013 FR-S)		

INSTALLATION

HINT:

- Use the same procedure for the RH and LH sides.
- The procedure listed below is for the RH side.

1. INSTALL FRONT NO. 2 SPEAKER ASSEMBLY

(a) Engage the 3 claws to install the front No. 2 speaker assembly.

NOTICE:

Do not touch the cone part of the speaker.

2. INSTALL NO. 1 INSTRUMENT PANEL SPEAKER PANEL SUB-ASSEMBLY

INFO



cardiagn.com

Last Modified: 3-27-2012	6.4 A	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM000000VEO02CX
Title: AUDIO / VIDEO: INSTRUMENT PANEL SPEAKER (for 6 Speakers): REMOVAL (2013 FR-S)		

REMOVAL


HINT:

- Use the same procedure for the RH and LH sides.
- The procedure listed below is for the RH side.

1. REMOVE NO. 1 INSTRUMENT PANEL SPEAKER PANEL SUB-ASSEMBLY

[INFO](#)

2. REMOVE FRONT NO. 2 SPEAKER ASSEMBLY

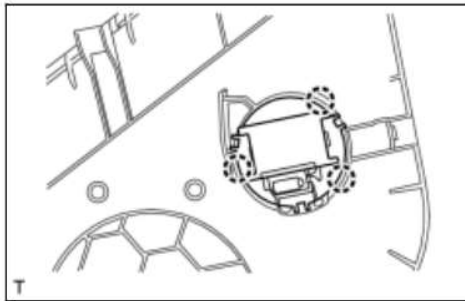

- (a) Disengage the 3 claws and remove the front No. 2 speaker assembly from the No. 2 instrument speaker panel sub-assembly.

NOTICE:


Do not touch the cone part of the speaker.



Last Modified: 3-27-2012	6.4 K	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM000003AW400WX
Title: AUDIO / VIDEO: INSTRUMENT PANEL SPEAKER (for 8 Speakers): COMPONENTS (2013 FR-S)		

COMPONENTS

ILLUSTRATION

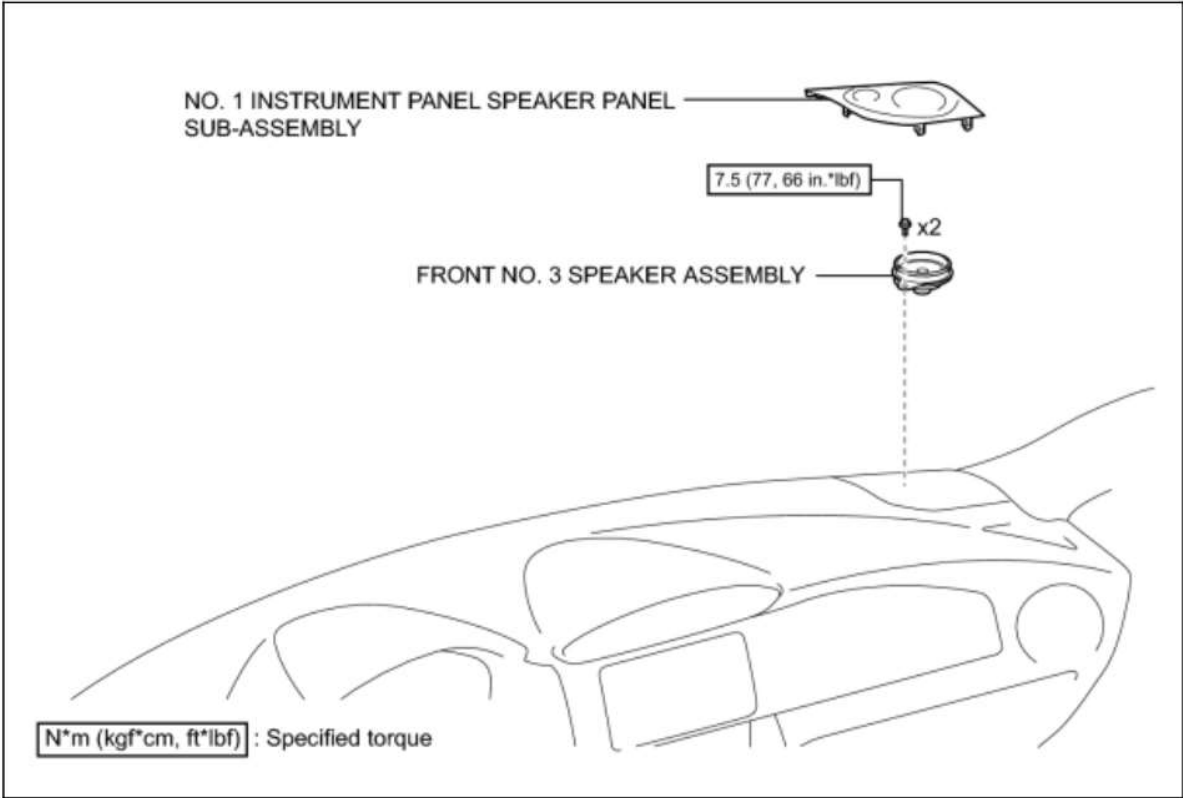

Last Modified: 3-27-2012	6.4 G	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM000000VEM01VX
Title: AUDIO / VIDEO: INSTRUMENT PANEL SPEAKER (for 8 Speakers): INSPECTION (2013 FR-S)		


INSPECTION

1. INSPECT FRONT NO. 3 SPEAKER ASSEMBLY

(a) Check that there is no foreign matter in the front No. 3 speaker assembly, no tears on the front No. 3 speaker assembly cone or other abnormalities.

(b) Measure the resistance of the front No. 3 speaker assembly.

Standard Resistance:

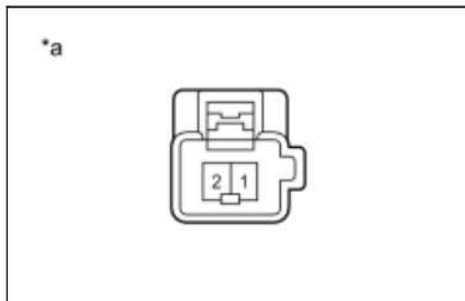

TESTER CONNECTION	CONDITION	SPECIFIED CONDITION
1 - 2	Always	3.7 to 4.7 Ω

If the result is not as specified, replace the front No. 3 speaker assembly.

Text in Illustration

*a	Component without harness connected (Front No. 3 speaker assembly)
----	---



Last Modified: 3-27-2012	6.4 A	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM000000VEL02HX
Title: AUDIO / VIDEO: INSTRUMENT PANEL SPEAKER (for 8 Speakers): INSTALLATION (2013 FR-S)		

INSTALLATION

HINT:

- Use the same procedure for the RH and LH sides.
- The procedure listed below is for the RH side.

1. INSTALL FRONT NO. 3 SPEAKER ASSEMBLY

- (a) Connect the connector.
- (b) Install the front No. 3 speaker assembly with the 2 bolts.

Torque: 7.5 N·m (77 kgf·cm, 66in·lbf)

NOTICE:

Do not touch the cone part of the speaker.

2. INSTALL NO. 1 INSTRUMENT PANEL SPEAKER PANEL SUB-ASSEMBLY



Last Modified: 3-27-2012	6.4 A	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM000000VEO02DX
Title: AUDIO / VIDEO: INSTRUMENT PANEL SPEAKER (for 8 Speakers): REMOVAL (2013 FR-S)		

REMOVAL

HINT:


- Use the same procedure for the RH and LH sides.
- The procedure listed below is for the RH side.

1. REMOVE NO. 1 INSTRUMENT PANEL SPEAKER PANEL SUB-ASSEMBLY

[INFO](#)

2. REMOVE FRONT NO. 3 SPEAKER ASSEMBLY

(a) Disconnect the connector.

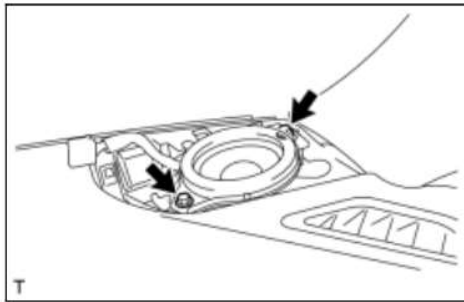

(b) Remove the 2 bolts and the front No. 3 speaker assembly.

NOTICE:


Do not touch the cone part of the speaker.



Last Modified: 3-27-2012	6.4 K	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM000001Q0002AX
Title: AUDIO / VIDEO: MICROPHONE: COMPONENTS (2013 FR-S)		

COMPONENTS

ILLUSTRATION

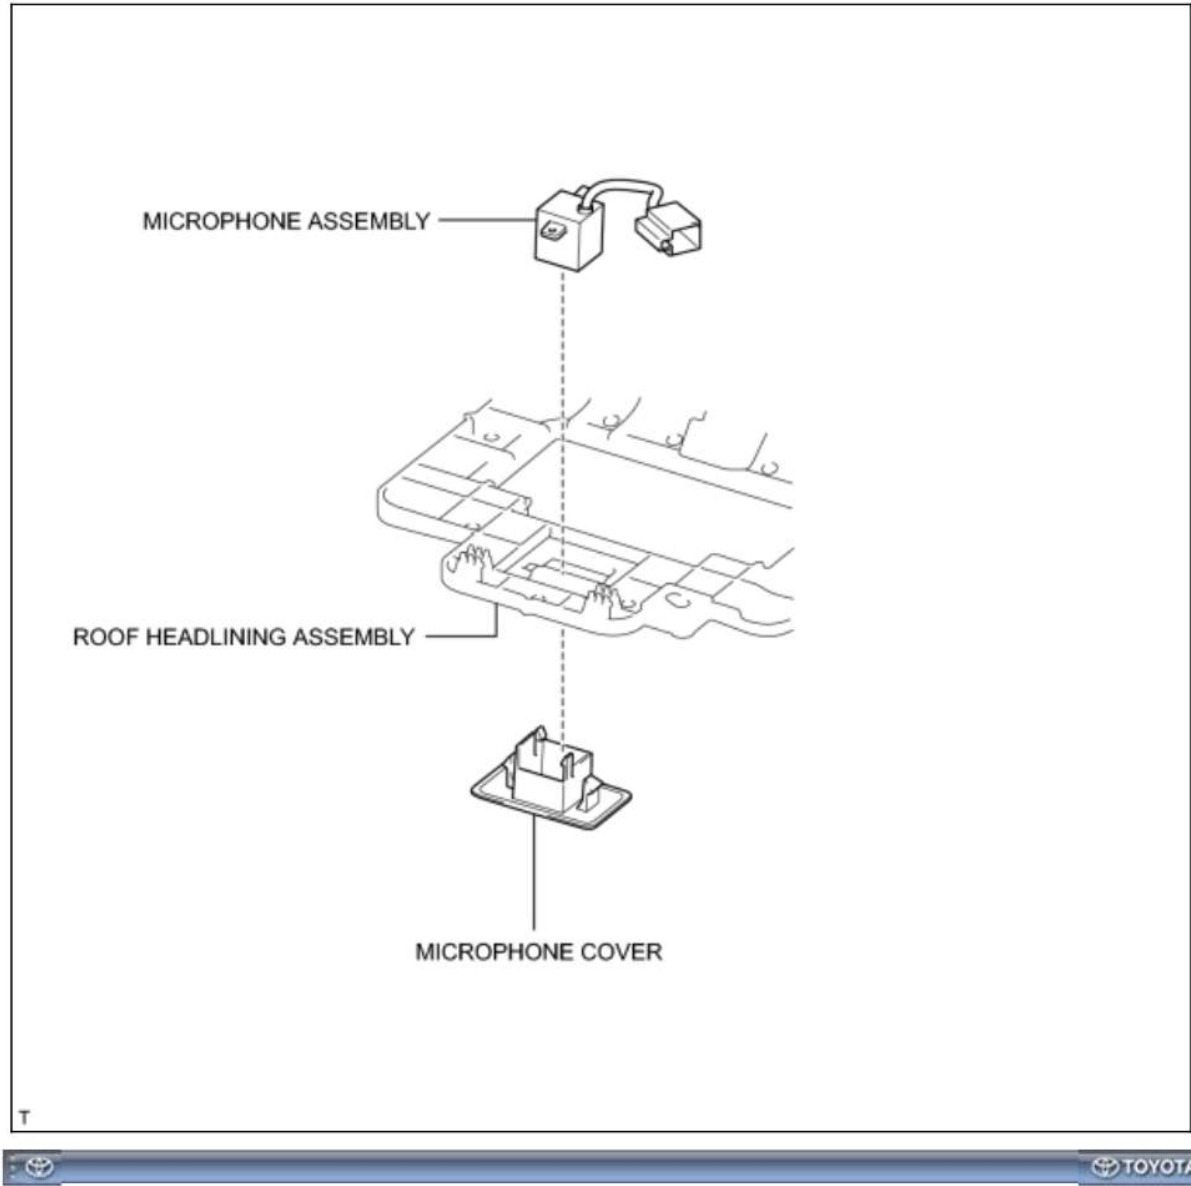

Last Modified: 3-27-2012	6.4 A	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM000001PZZ03CX
Title: AUDIO / VIDEO: MICROPHONE: INSTALLATION (2013 FR-S)		

INSTALLATION

1. INSTALL MICROPHONE COVER

- (a) Engage the 2 claws to install the microphone cover.

2. INSTALL MICROPHONE ASSEMBLY

- (a) Engage the 2 claws to install the microphone assembly.
- (b) Connect the connector.

3. INSTALL ROOF HEADLINING ASSEMBLY




Last Modified: 3-27-2012	6.4 A	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM000001Q0103CX
Title: AUDIO / VIDEO: MICROPHONE: REMOVAL (2013 FR-S)		

REMOVAL


1. REMOVE ROOF HEADLINING ASSEMBLY

INFO

2. REMOVE MICROPHONE ASSEMBLY

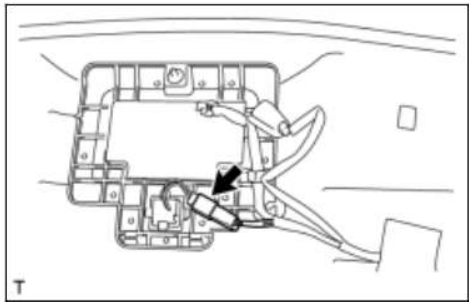


(a) Disconnect the connector.

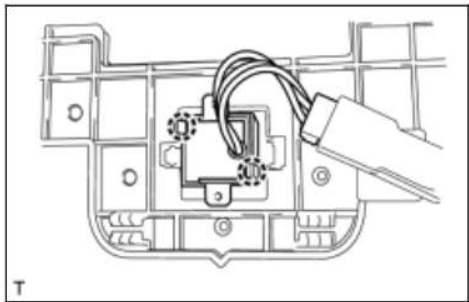

(b) Disengage the 2 claws to remove the microphone assembly.

3. REMOVE MICROPHONE COVER

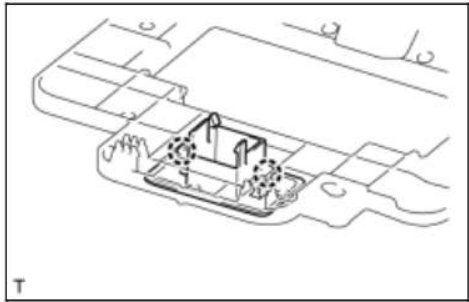


(a) Disengage the 2 claws to remove the microphone cover.

Last Modified: 3-27-2012	6.4 K	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM000004O0U001X
Title: AUDIO / VIDEO: NOISE FILTER: COMPONENTS (2013 FR-S)		

COMPONENTS

ILLUSTRATION

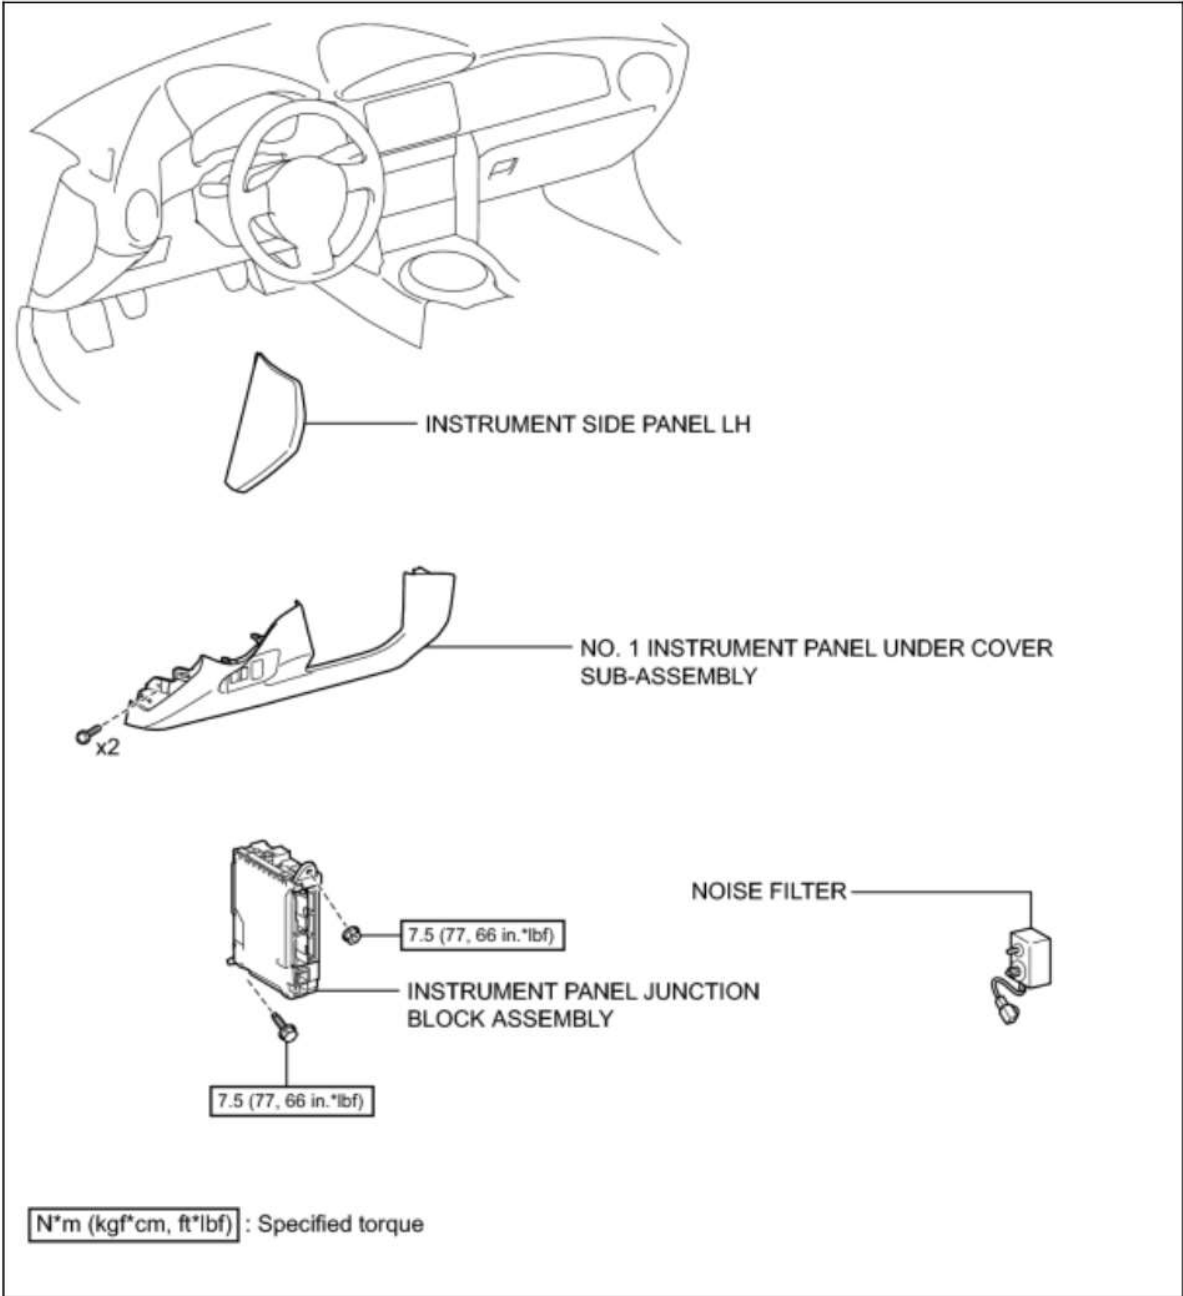


Last Modified: 3-27-2012	6.4 G	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM000003ZDZ019X
Title: AUDIO / VIDEO: NOISE FILTER: INSPECTION (2013 FR-S)		

INSPECTION

1. INSPECT NOISE FILTER

- (a) Measure the resistance of the noise filter according to the value(s) in the table below.

Standard Resistance:

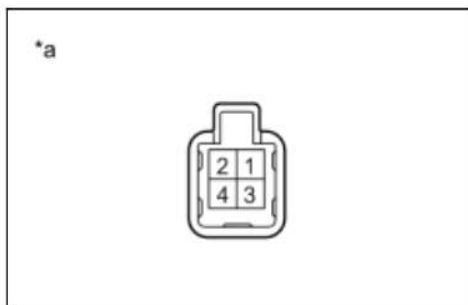

TESTER CONNECTION	CONDITION	SPECIFIED CONDITION
1 - 2	Always	10 k Ω or higher
1 - 4	Always	Below 1 Ω

Text in Illustration

*a	Component without harness connected (Noise Filter)
----	---



Last Modified: 3-27-2012	6.4 A	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM0000042IC00MX
Title: AUDIO / VIDEO: NOISE FILTER: INSTALLATION (2013 FR-S)		

INSTALLATION

1. INSTALL NOISE FILTER

- (a) Engage the guide and install the radio setting condenser.
- (b) Engage the 2 clamps.
- (c) Connect the connector.

2. INSTALL INSTRUMENT PANEL JUNCTION BLOCK ASSEMBLY INFO

3. INSTALL NO. 1 INSTRUMENT PANEL UNDER COVER SUB-ASSEMBLY INFO

4. INSTALL INSTRUMENT SIDE PANEL LH INFO



Last Modified: 3-27-2012	6.4 A	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM0000042IE00LX
Title: AUDIO / VIDEO: NOISE FILTER: REMOVAL (2013 FR-S)		

REMOVAL

1. REMOVE INSTRUMENT SIDE PANEL LH

[INFO](#)

2. REMOVE NO. 1 INSTRUMENT PANEL UNDER COVER SUB-ASSEMBLY


[INFO](#)

3. REMOVE INSTRUMENT PANEL JUNCTION BLOCK ASSEMBLY


[INFO](#)

4. REMOVE NOISE FILTER

(a) Disconnect the connector.

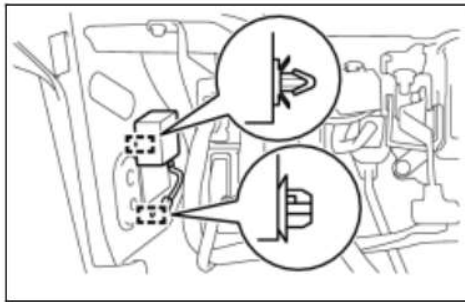

(b) Disengage the 2 clamps.

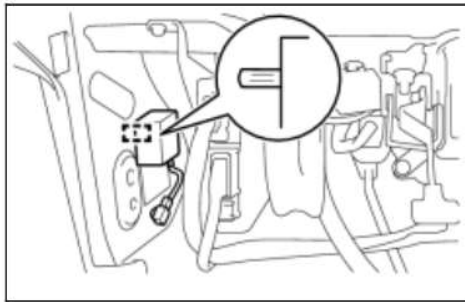


(c) Disengage the guide and remove the noise filter.



Last Modified: 3-27-2012	6.4 K	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM000004MZ8007X
Title: AUDIO / VIDEO: QUARTER TRIM SPEAKER: COMPONENTS (2013 FR-S)		

COMPONENTS

ILLUSTRATION

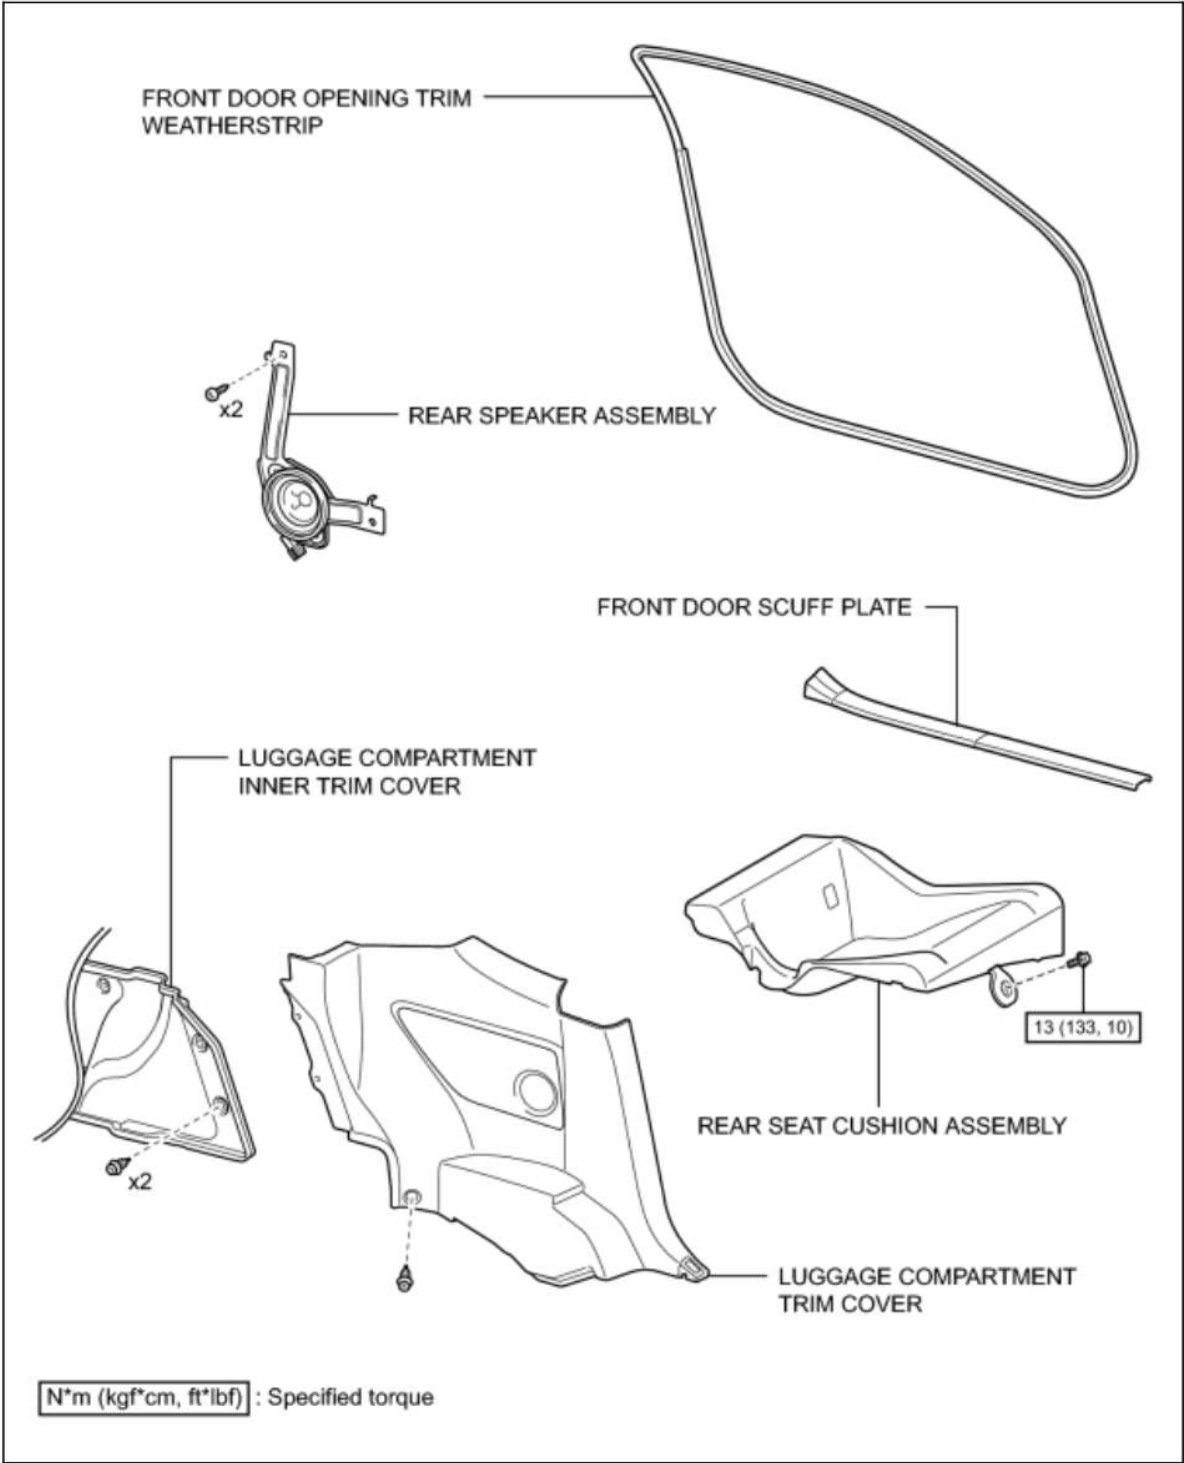


cardiagn.com

Last Modified: 3-27-2012	6.4 G	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM000004O9Y003X
Title: AUDIO / VIDEO: QUARTER TRIM SPEAKER: INSPECTION (2013 FR-S)		

INSPECTION

1. INSPECT REAR SPEAKER ASSEMBLY

- (a) With the rear speaker assembly installed, check that there is no looseness or other abnormalities.
- (b) Check that there is no foreign matter in the rear speaker assembly, no tears on the rear speaker assembly cone or other abnormalities.
- (c) Measure the resistance of the rear speaker assembly.
- Standard Resistance:

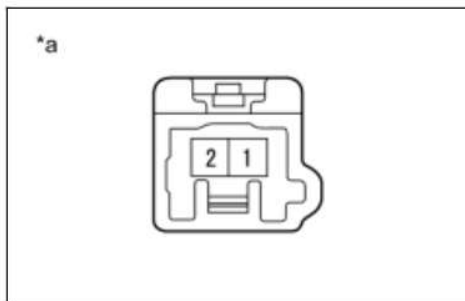

TESTER CONNECTION	CONDITION	SPECIFIED CONDITION
1 - 2	Always	5.1 to 6.9 Ω

If the result is not as specified, replace the rear speaker assembly.

Text in Illustration

*a	Component without harness connected (Rear speaker assembly)
----	--



Last Modified: 3-27-2012	6.4 A	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM000004MZ700AX
Title: AUDIO / VIDEO: QUARTER TRIM SPEAKER: INSTALLATION (2013 FR-S)		

INSTALLATION

HINT:

- Use the same procedure for both the RH and LH sides.
- The procedure described below is for the LH side.

1. INSTALL REAR SPEAKER ASSEMBLY

(a) Install the rear speaker assembly with the 2 screws.

NOTICE:

Do not touch the speaker cone.

(b) Connect the connector.

2. INSTALL LUGGAGE COMPARTMENT TRIM COVER

INFO

3. CONNECT LUGGAGE COMPARTMENT INNER TRIM COVER

INFO

4. INSTALL REAR SEAT CUSHION ASSEMBLY

INFO

5. INSTALL FRONT DOOR SCUFF PLATE

INFO

6. INSTALL FRONT DOOR OPENING TRIM WEATHERSTRIP

INFO



cardiagn.com

Last Modified: 3-27-2012	6.4 A	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM000004MZ900AX
Title: AUDIO / VIDEO: QUARTER TRIM SPEAKER: REMOVAL (2013 FR-S)		

REMOVAL

HINT:

- Use the same procedure for both the RH and LH sides.
- The procedure described below is for the LH side.

1. DISCONNECT FRONT DOOR OPENING TRIM WEATHERSTRIP

HINT:

Disconnect the front door opening trim weatherstrip to the extent that allows the removal of the luggage compartment trim cover.


2. REMOVE FRONT DOOR SCUFF PLATE INFO

3. REMOVE REAR SEAT CUSHION ASSEMBLY INFO

4. SEPARATE LUGGAGE COMPARTMENT INNER TRIM COVER INFO

5. REMOVE LUGGAGE COMPARTMENT TRIM COVER INFO

6. REMOVE REAR SPEAKER ASSEMBLY

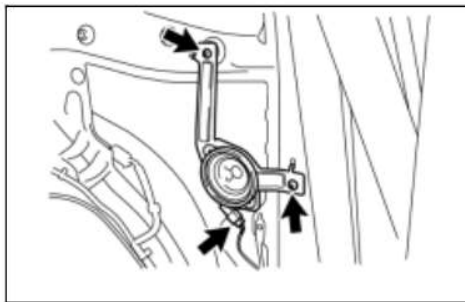

(a) Disconnect the connector.

(b) Remove the 2 screws and the rear speaker assembly.

NOTICE:


Do not touch the speaker cone.



Last Modified: 3-27-2012	6.4 K	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM000001PZU02AX
Title: AUDIO / VIDEO: RADIO ANTENNA CORD: COMPONENTS (2013 FR-S)		


COMPONENTS

ILLUSTRATION

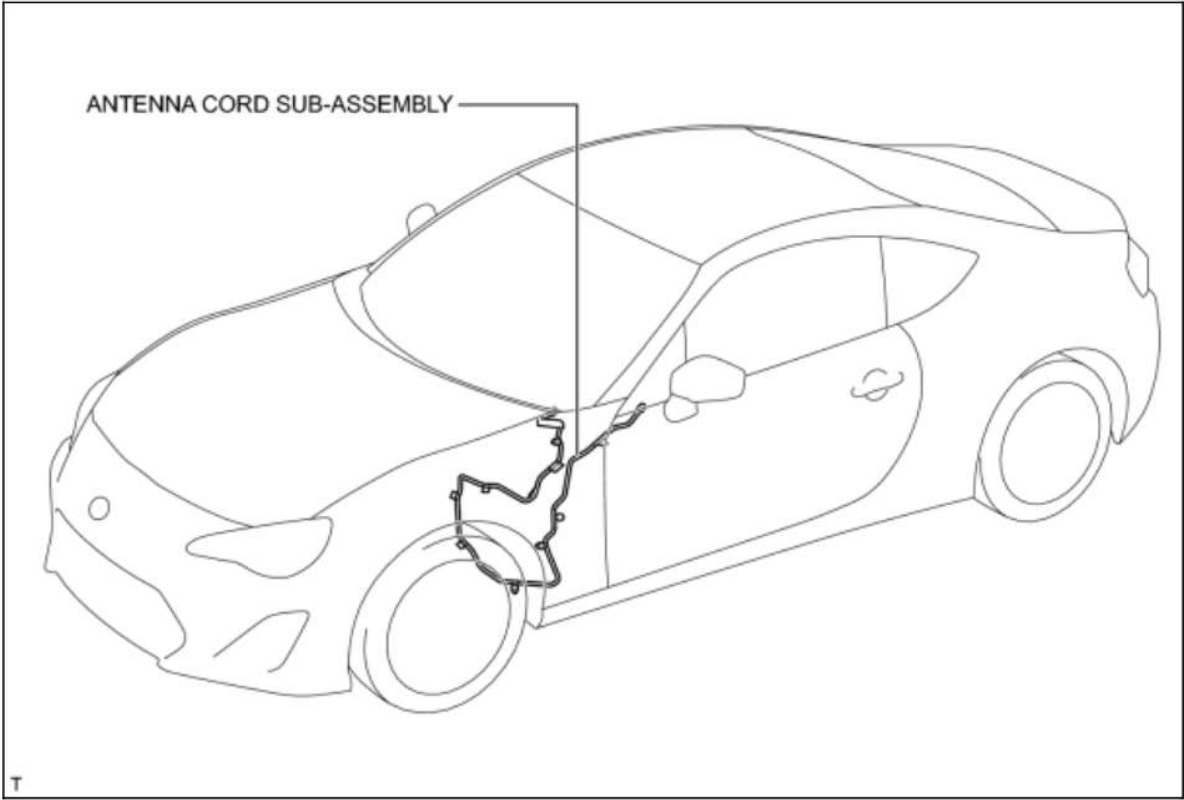

ILLUSTRATION

cardiagn.com

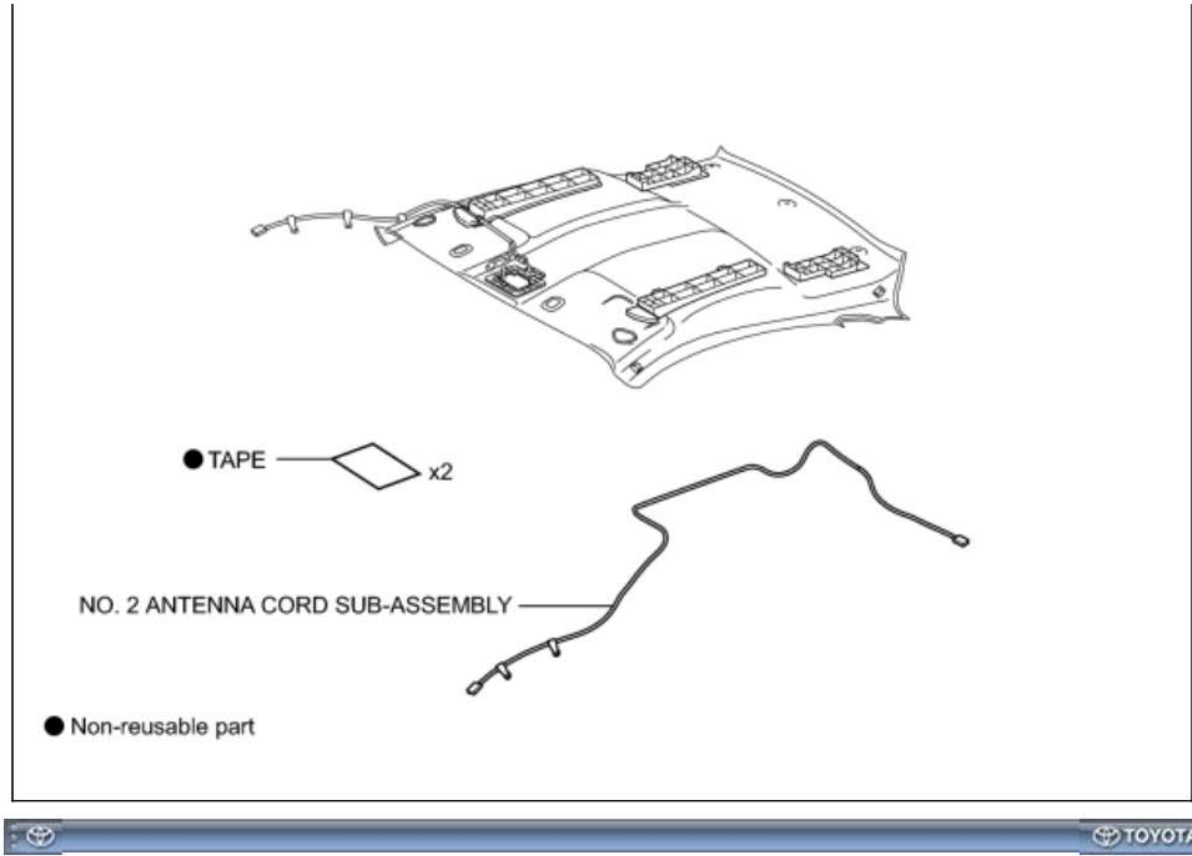


Last Modified: 3-27-2012	6.4 A	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM0000024DA09GX
Title: AUDIO / VIDEO: RADIO ANTENNA CORD: INSTALLATION (2013 FR-S)		

INSTALLATION

1. INSTALL NO. 2 ANTENNA CORD SUB-ASSEMBLY

- (a) Align the locating tape of the No. 2 antenna cord sub-assembly as shown in the illustration, and then engage the 8 clamps.

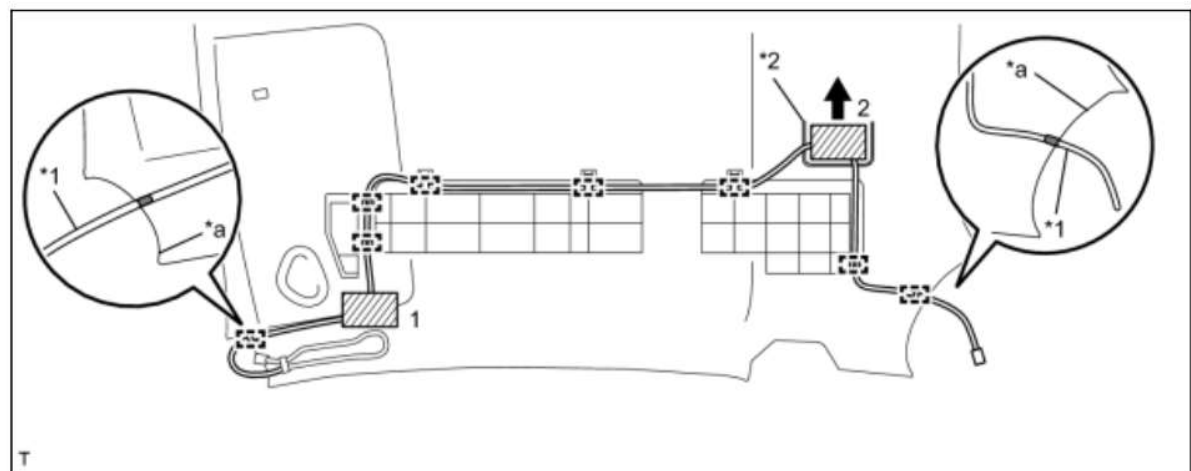

Text in Illustration

*1	No. 2 Antenna Cord Sub-assembly	*2	Marking Line
*a	End of Roof Headlining Assembly	-	-
	Adhesive Tape		Locating Tape

- (b) Fix the No. 2 antenna cord sub-assembly on the roof headlining assembly with adhesive tape as shown in the illustration.

HINT:

- Fix the No. 2 antenna cord sub-assembly in the order shown in the illustration.
- When applying the 2nd tape, remove the looseness of the No. 2 antenna cord sub-assembly by pulling it in the direction indicated by the arrow in the illustration.

2. INSTALL ROOF HEADLINING ASSEMBLY

INFO

3. INSTALL ANTENNA CORD SUB-ASSEMBLY

- (a) Engage the 9 clamps and install the antenna cord sub-assembly.
- (b) Install the floor mat.

4. INSTALL AIR CONDITIONING RADIATOR ASSEMBLY

INFO



cardiagn.com

Last Modified: 3-27-2012	6.4 A	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM000001OGD05KX
Title: AUDIO / VIDEO: RADIO ANTENNA CORD: REMOVAL (2013 FR-S)		

REMOVAL


1. REMOVE AIR CONDITIONING RADIATOR ASSEMBLY

INFO


2. REMOVE ROOF HEADLINING ASSEMBLY

INFO

3. REMOVE ANTENNA CORD SUB-ASSEMBLY

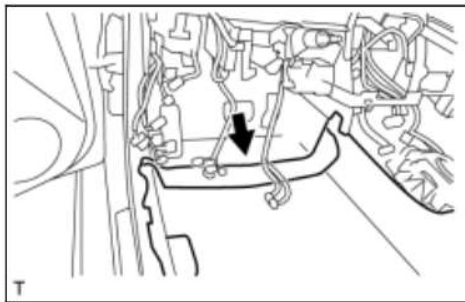

(a) Peel back the floor carpet LH side.

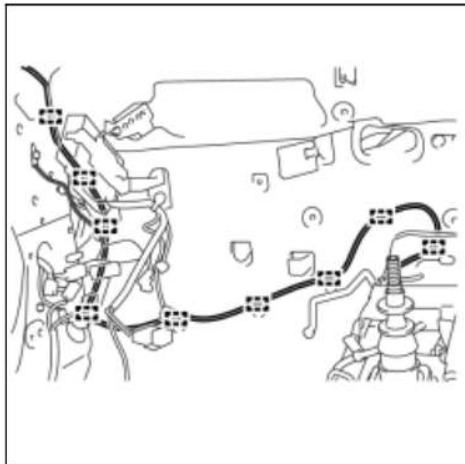


(b) Disengage the 9 clamps and remove the antenna cord sub-assembly.

4. REMOVE NO. 2 ANTENNA CORD SUB-ASSEMBLY

(a) Remove the 2 adhesive tapes.

(b) Disengage the 8 clamps and remove the No. 2 antenna cord sub-assembly from the roof headlining.

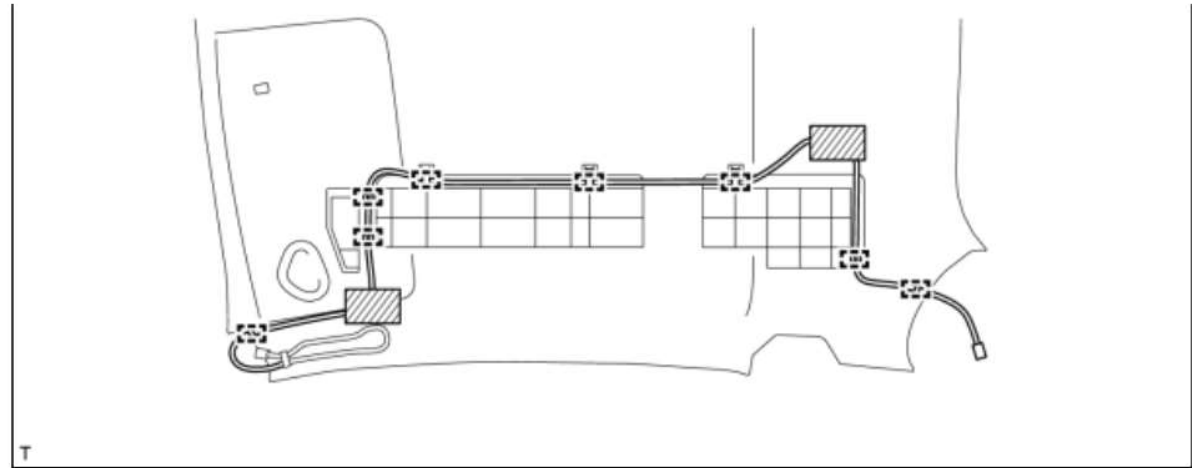

Text in Illustration


	Adhesive Tape	-	-
---	---------------	---	---



Last Modified: 3-27-2012	6.4 K	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM000004MZB002X
Title: AUDIO / VIDEO: RADIO ANTENNA POLE: COMPONENTS (2013 FR-S)		

COMPONENTS

ILLUSTRATION

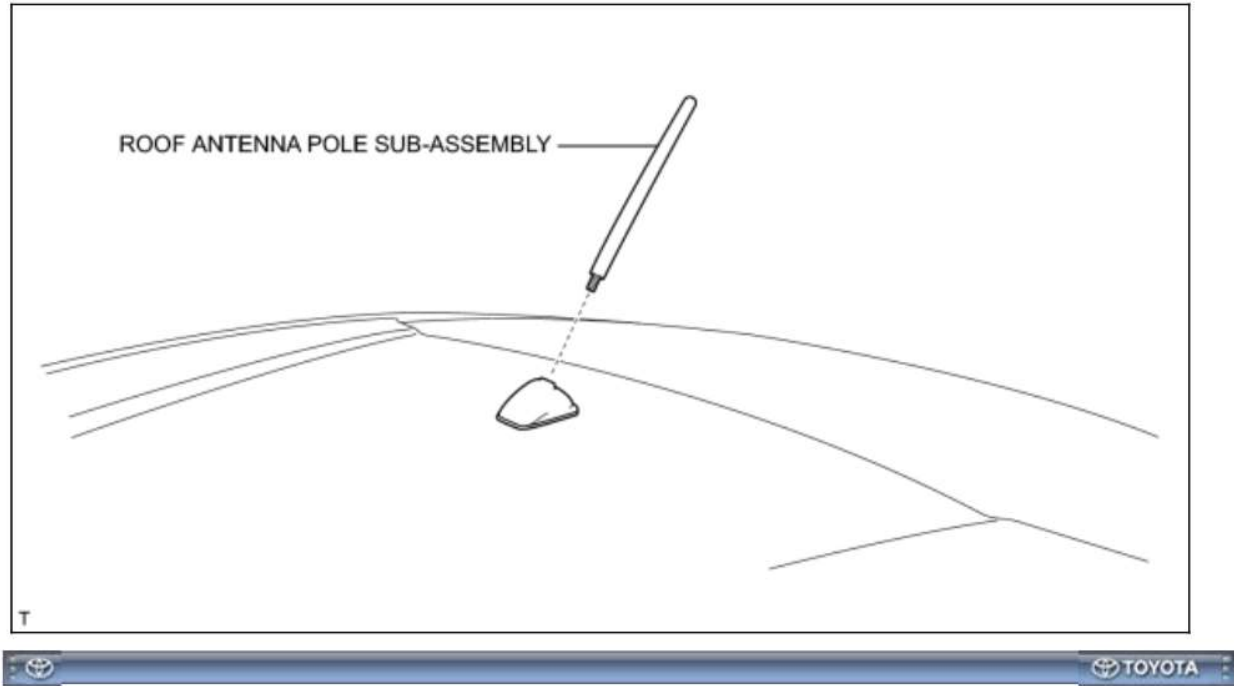


cardiagn.com

Last Modified: 3-27-2012	6.4 A	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM000004MZA008X
Title: AUDIO / VIDEO: RADIO ANTENNA POLE: INSTALLATION (2013 FR-S)		

INSTALLATION

1. INSTALL ROOF ANTENNA POLE SUB-ASSEMBLY

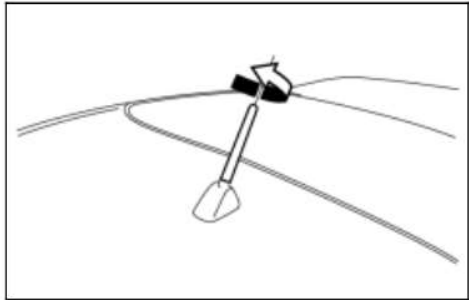


- (a) Turn the roof antenna pole sub-assembly in the direction indicated by the arrow in the illustration to install it.



Last Modified: 3-27-2012	6.4 A	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM000004MZC008X
Title: AUDIO / VIDEO: RADIO ANTENNA POLE: REMOVAL (2013 FR-S)		

REMOVAL

1. REMOVE ROOF ANTENNA POLE SUB-ASSEMBLY

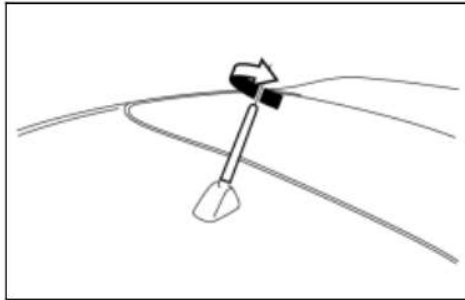


- (a) Turn the roof antenna pole sub-assembly in the direction indicated by the arrow in the illustration to remove it.



Last Modified: 3-27-2012	6.4 K	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM000001PZF01DX
Title: AUDIO / VIDEO: STEREO COMPONENT AMPLIFIER: COMPONENTS (2013 FR-S)		

COMPONENTS

ILLUSTRATION

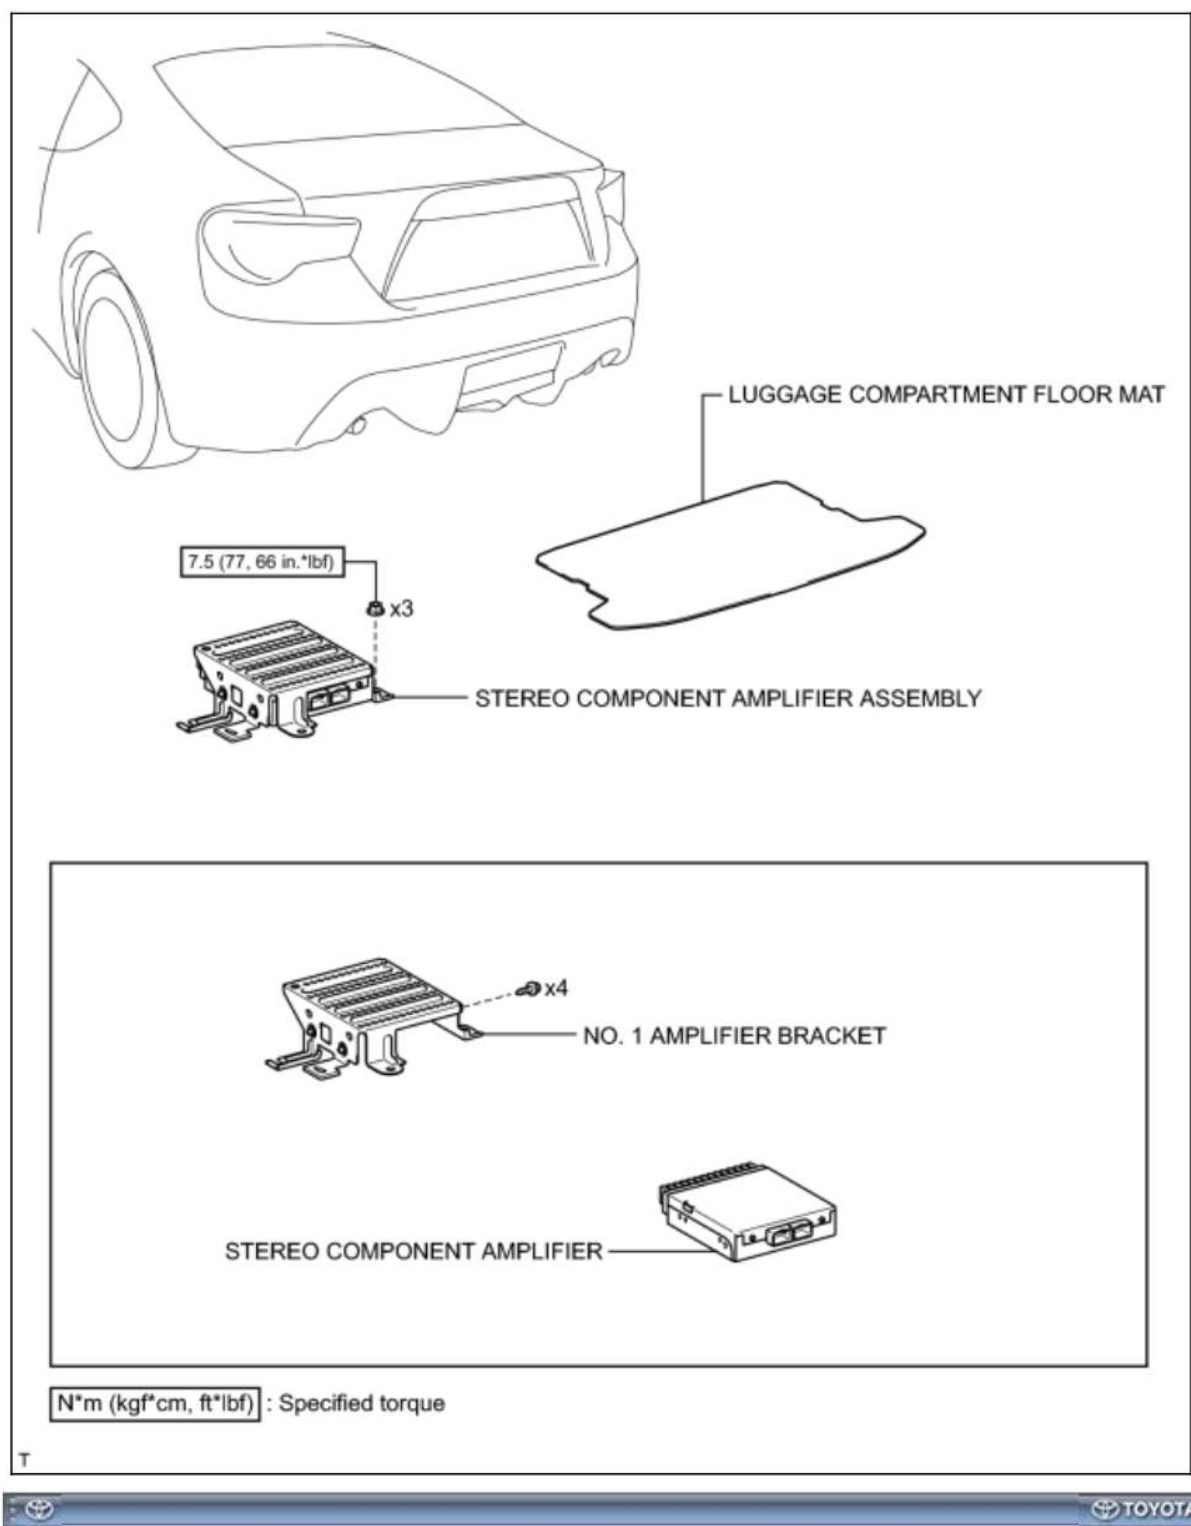

Last Modified: 3-27-2012	6.4 A	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM000001PZE010X
Title: AUDIO / VIDEO: STEREO COMPONENT AMPLIFIER: INSTALLATION (2013 FR-S)		

INSTALLATION

1. INSTALL STEREO COMPONENT AMPLIFIER ASSEMBLY

- (a) Install the No. 1 amplifier bracket with the 4 screws.
- (b) Install the stereo component amplifier assembly with bracket with the 3 nuts.
Torque: 7.5 N·m (77 kgf·cm, 66in·lbf)
- (c) Connect the 2 connectors to the stereo component amplifier assembly with bracket.
- (d) Engage the clamp and connect the wire harness to the stereo component amplifier cover.
- (e) Install the clip and connect the rear seat back cover.

2. INSTALL LUGGAGE COMPARTMENT FLOOR MAT

- (a) Install the luggage compartment floor mat.




Last Modified: 3-27-2012	6.4 A	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM000001PZG010X
Title: AUDIO / VIDEO: STEREO COMPONENT AMPLIFIER: REMOVAL (2013 FR-S)		

REMOVAL


1. REMOVE LUGGAGE COMPARTMENT FLOOR MAT

- (a) Remove the luggage compartment floor mat.


2. REMOVE STEREO COMPONENT AMPLIFIER ASSEMBLY

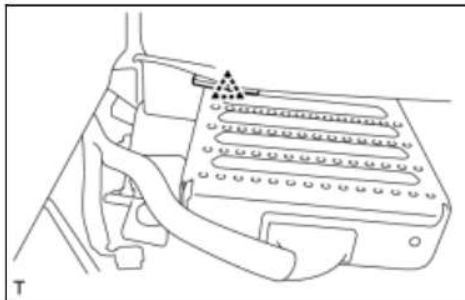


- (a) Remove the clip and separate the rear seat back cover.

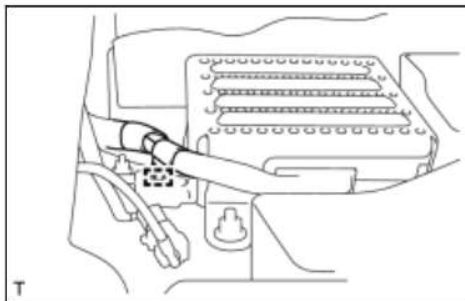


- (b) Disconnect the clamp and the wire harness from the stereo component amplifier cover.

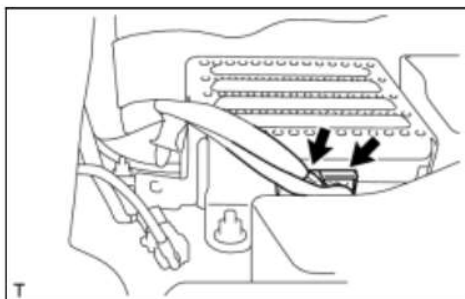

- (c) Disconnect the 2 connectors from the stereo component amplifier.

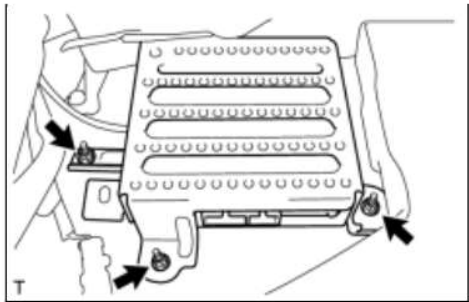

(d) Remove the 3 nuts and the stereo component amplifier.

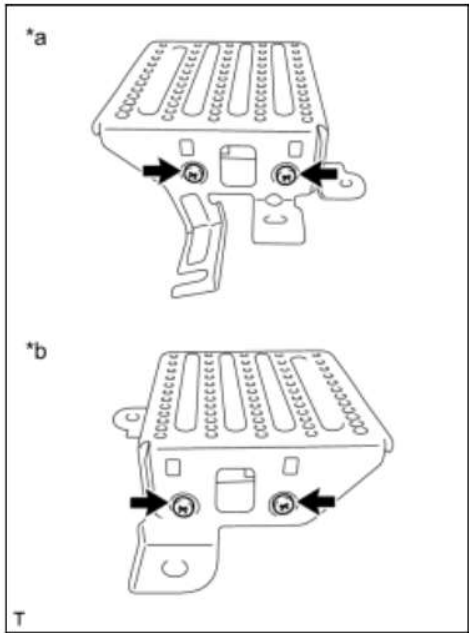

(e) Remove the 4 screws and No. 1 amplifier bracket.

Text in Illustration


*a	LH Side
*b	RH Side



Last Modified: 3-27-2012	6.4 K	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM000001TAC01LX
Title: AUDIO / VIDEO: STEREO JACK ADAPTER ASSEMBLY: COMPONENTS (2013 FR-S)		

COMPONENTS

ILLUSTRATION

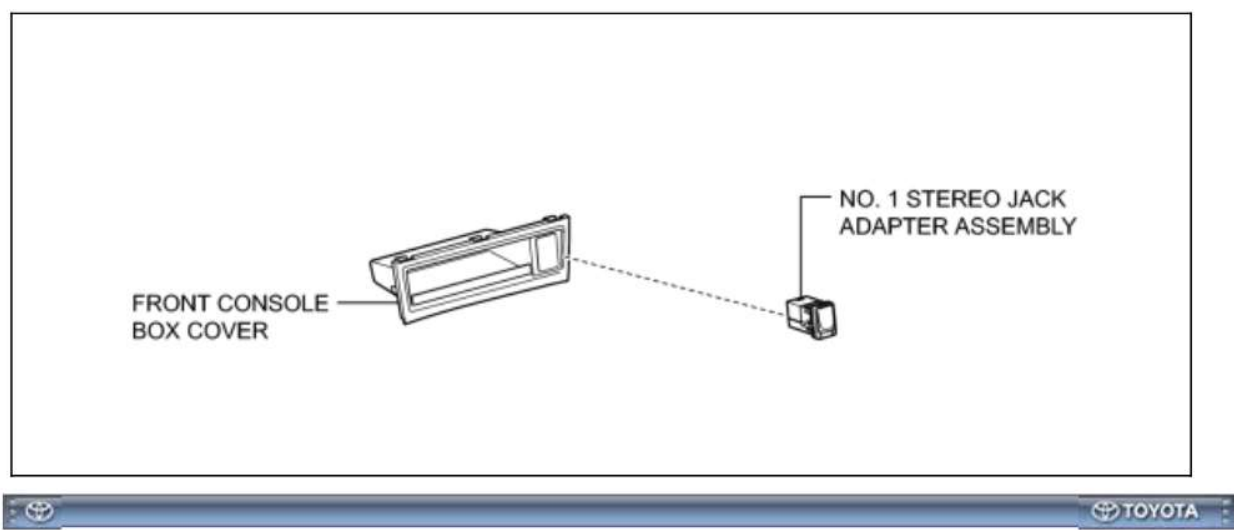

Last Modified: 3-27-2012	6.4 A	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM000001TAB01YX
Title: AUDIO / VIDEO: STEREO JACK ADAPTER ASSEMBLY: INSTALLATION (2013 FR-S)		

INSTALLATION

1. INSTALL NO. 1 STEREO JACK ADAPTER ASSEMBLY

(a) Engage the 2 claws to install the No. 1 stereo jack adapter assembly.


2. INSTALL FRONT CONSOLE BOX COVER INFO



Last Modified: 3-27-2012	6.4 A	From: 201203
Model Year: 2013	Model: FR-S	Doc ID: RM000001TAD01YX
Title: AUDIO / VIDEO: STEREO JACK ADAPTER ASSEMBLY: REMOVAL (2013 FR-S)		

REMOVAL

1. REMOVE FRONT CONSOLE BOX COVER INFO
2. REMOVE NO. 1 STEREO JACK ADAPTER ASSEMBLY

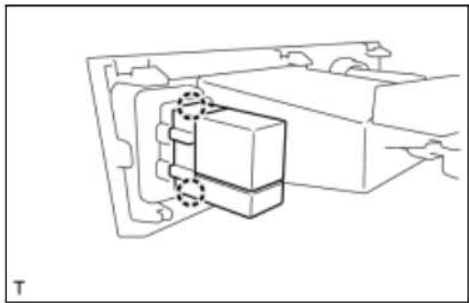

(a) Disengage the 2 claws and remove the No. 1 stereo jack adapter assembly.

