


Porsche 911 1997 – 2004 fuse box diagram

Fuse Box

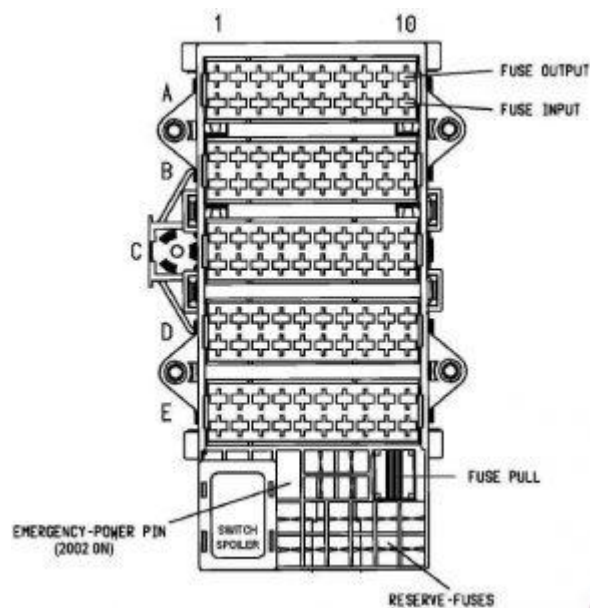

Porsche 996 – fuse box diagram

Number	Ampere rating [A]	Circuit protected
A1	7,5	1997-1998: High Beam Right
	15	1999-2004: High Beam Right, High Beam Control
A2	7,5	1997-1998: High Beam Left
	15	1999-2004: High Beam Left
A3	7,5	Side Marker Light Right
A4	7,5	Side Marker Light Left
A5	15	License Plate Lights, Instrument Lights, Locating Light (2002-2004)

A6	25	Seat Heater
A7	25	Fog Light, Rear Fog Light
A8	7,5	License Plate Lights (Canada)
A9	7,5	1997-1998: Low Beam Right
	15	1999-2004: Low Beam Right
A10	7,5	1997-1998: Low Beam Left
	15	1999-2004: Low Beam Left
B1	15	Cluster, Tiptronic, Button ASR ON/OFF (PSM), Diagnosis, Power Top
B2	7,5	1997-2000: Radio, InfoSystem (1997-1998)
	15	2001-2004: Hazard-Warning, A.Turn-Signal System
B3	25	Two-Tone Horns
B4	15	Engine Compartment Blower
B5	7,5	Backup Light, CU Memory Mirror Adjustment, CU Power Top
B6	15	1997-1998: Hazard-Warning Light Switch 1999-2004: Turn Signals, Power Window

B7	15	Stop Light, Cruise Control
B8	15	CU CLS Alarm, CU DME/ME (Engine Electronics), CU Tiptronic
B9	15	1997-1998: CU ABS Traction Control 1999-2004: CU ABS, ASR, PSM
B10	15	Instrument Cluster Diagnosis, Headlight Vertical Aim Control (1999-2004)
C1	25	Relay MFI~DI (Engine Electronics)
C2	30	Ignition, Oxygen Sensor Heater
C3	15	1997-1998: CU Alarm System, Central Locking System, Power Window 1999-2004: CU CLS Alarm, Power Window, Sun Roof, CU Power Top, Inside Light
C4	25	1997-2001: Fuel Pump
	30	2002-2004: Fuel Pump
C5	—	—
C6	25	Wiper
C7	7,5	Term.X Control Wires
C8	30	1997-2001: Radiator Fan 2 (Right)

	40	2002-2004: Radiator Fan 2 (Right)
C9	25	Headlight Cleaning System
C10	30	1997-2001: Radiator Fan 1 (Left)
	40	2002-2004: Radiator Fan 1 (Left)
D1	30	Power Window
D2	30	Mirror Heating, Rear Window Defogger
D3	30	Convertible Top Drive, Sun Roof (1999-2004)
D4	30	Power Window Rear (Convertible)
D5	15	Cigar Lighter
D6	30	Heater Air Conditioning System
D7	15	1997-1998: Hazard Warning Light Switch 1999-2000: Hazard Warning, A.Turn Signal System 2001-2004: Rear Spoiler Cover Opener
D8	15	1997-2000: Spoiler Extension 2001: Radio
	7,5	2002-2004: Radio

D9	15	Audio Option Pack
D10	7,5	1997-2001: Mounting Point For Retrofit (<i>Warning Maximum of 5</i>) 2002-2004: Telephone
E1	7,5	Term.86S, CU-CL Alarm, Radio, Cluster CU Info System, Daytime Running Light (1999-2004), CU Sensor Overturn (1999-2004)
E2	7,5	CU Memory
E3	30	Power Seat, CU Memory Seat Left
E4	30	Power Seat, CU Memory Seat Right
E5	7,5	InfoSystem
E6	7,5	Term.30 Telephone/Handy, Navigation Control Unit, ORVR (1999-2004)
E7	7,5	Air Conditioning System
E8	7,5	Term.15 Telephone/Handy InfoSystem
E9	30	1997-1998: FDR 1999-2001: PSM
	25	2002-2004: PSM
E10	30	1997-1998: FDR 1999-2001: PSM

	15	2002-2004: PSM
--	----	----------------